

General Information

Date & Time: 24, Nov, 2025 14:00

Make	Toyota	Model	Hiace
YOM	2021	Odo Meter Reading	46,206
Registration No.	NEF7552	Chassis No.	JTFNAFAP7L8018848
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



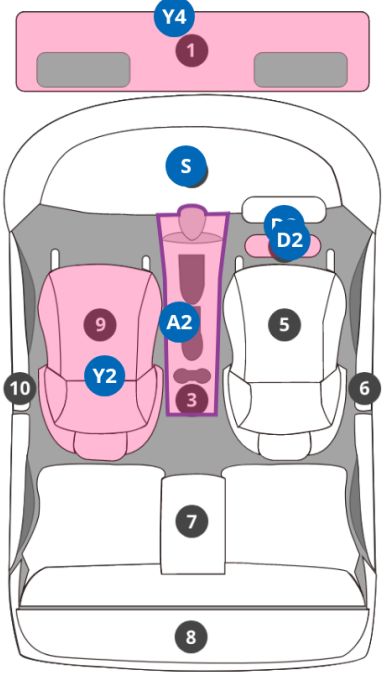
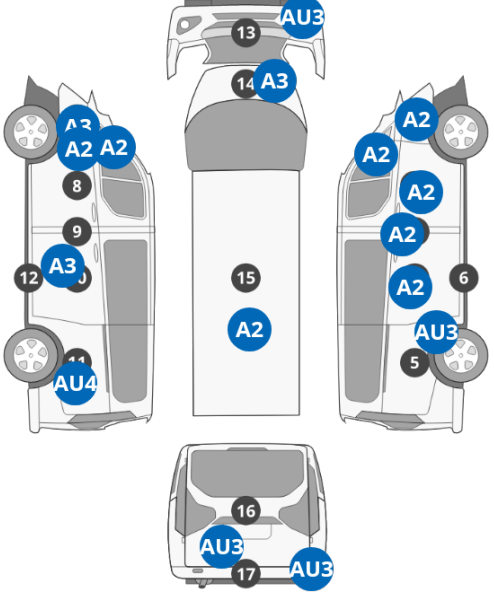
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	140.3	150	131	140
2	Boot Lid	122.6	129	117	122
3	Roof	140.7	149	180	113/121
4	Left Front Fender	124.0	116	130	126
5	Left Front Door	145.3	138	166	132
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	122.6	117	124	127
9	Right Front Fender	123.6	129	126	116
10	Right Front Door	128.6	120	132	134
11	Center Panel Right	139.6	138	160	121
12	Right Rear Door	123.0	125	123	121
13	Right Back Panel	132.0	141	130	125

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Display, Audio System - Missing - Yes / Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / (L) Front Seat - Grime - Small / Knobs - Worn, Peel, Crack - Small / Ceiling - Grime - Large / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Center Panel - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, no jack and tools, no spare tire, with LTO plate, scratches on headlight and tail light, radio unit missing,</p>