

General Information

Date & Time: 24, Nov, 2025 15:37

Make	Toyota	Model	Fortuner
YOM	2023	Odo Meter Reading	28,942
Registration No.	NHJ7980	Chassis No.	MHFCB8GS8N0528331
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



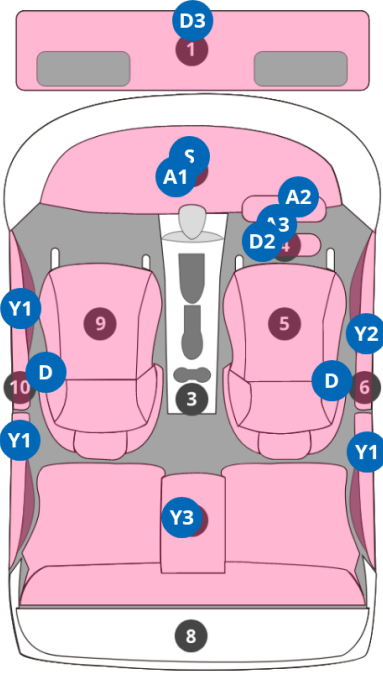
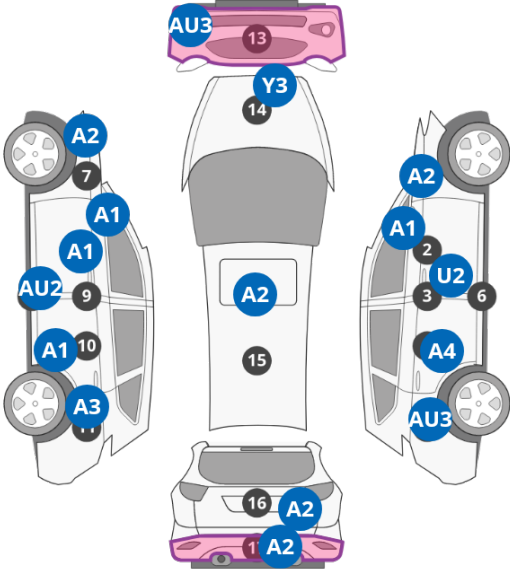
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	137.0	117	183	111
2	Boot Lid	97.0	95	105	91
3	Roof	118.1	128	136	112/97
4	Left Front Fender	111.3	106	123	105
5	Left Front Door	111.3	117	109	108
6	Center Panel Left				
7	Left Rear Door	99.3	110	99	89
8	Left Back Panel	113.6	126	106	109
9	Right Front Fender	110.6	108	111	113
10	Right Front Door	276.3	329	129	371
11	Center Panel Right				
12	Right Rear Door	258.3	290	108	377
13	Right Back Panel	252.3	314	133	310

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Floor Mat - Worked - Small / Glove Box - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / (L) Rear Trim - Grime - Minimal / (R) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Ceiling - Crinkle - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (R) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Crack, Gap - Medium / Roof - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on tail light ,front left signal light loose</p>