

General Information

Date & Time: 29, Nov, 2025 12:51

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	14,159
Registration No.	DBR3788	Chassis No.	PA1B18F37R4269614
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



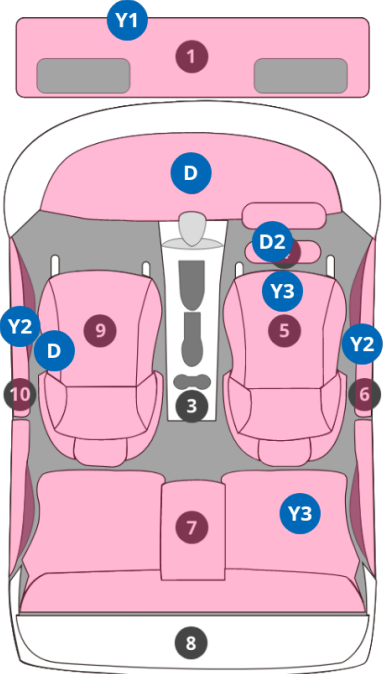
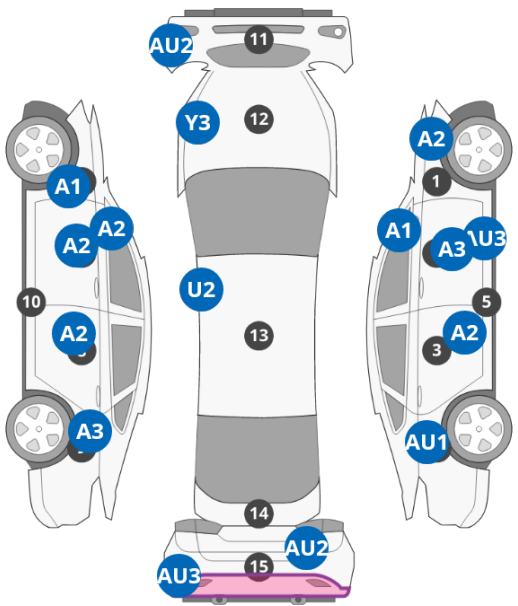
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.3	119	120	122
2	Boot Lid	111.0	110	109	114
3	Roof	108.5	111	100	116/107
4	Left Front Fender	117.6	133	114	106
5	Left Front Door	109.0	109	112	106
6	Center Panel Left				
7	Left Rear Door	110.3	108	111	112
8	Left Back Panel	128.0	129	135	120
9	Right Front Fender	121.3	117	138	109
10	Right Front Door	105.0	104	107	104
11	Center Panel Right				
12	Right Rear Door	111.0	116	110	107
13	Right Back Panel	111.3	106	113	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Crack, Gap - Medium / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with warranty booklet and jack, no tools, with spare tire, with LTO plate, scratches on tail light, head unit issue,</p>