

## General Information

Date & Time: 26, Nov, 2025 14:01

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	6,653
<b>Registration No.</b>	DCA7669	<b>Chassis No.</b>	PA1B18F30S4292562
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



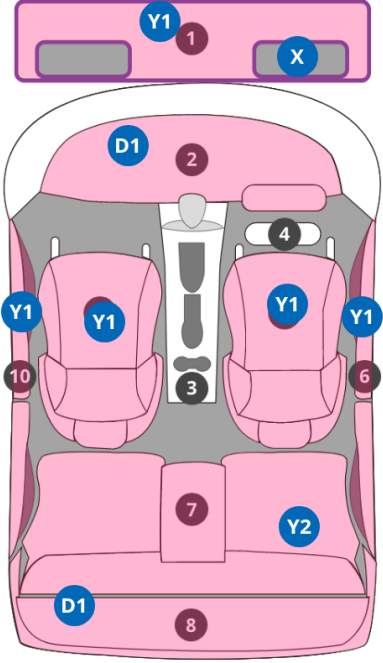
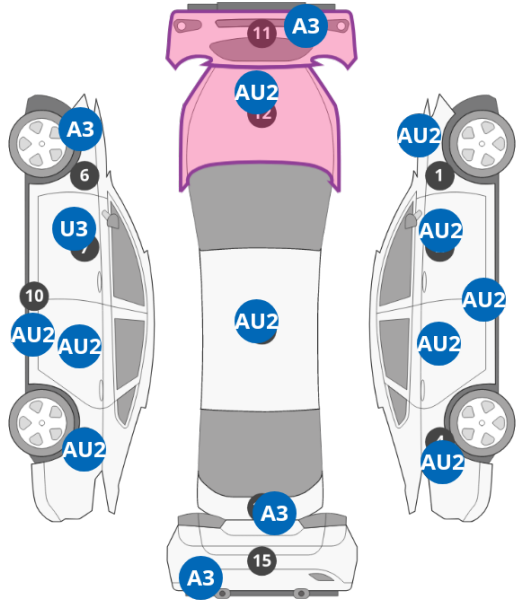
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	266.0	153	511	134
2	Boot Lid	114.6	102	114	128
3	Roof	113.0	115	114	109/114
4	Left Front Fender	111.3	113	102	119
5	Left Front Door	117.6	112	112	129
6	Center Panel Left				
7	Left Rear Door	118.3	119	110	126
8	Left Back Panel	113.6	122	115	104
9	Right Front Fender	123.6	130	116	125
10	Right Front Door	124.0	146	111	115
11	Center Panel Right				
12	Right Rear Door	114.3	115	111	117
13	Right Back Panel	114.3	104	112	127

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Minimal / Sunvisor, Sunglass Holder - Missing - Yes / Dashboard - Worked - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Small / Trunk Room - Worked - Minimal</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (L) Front Door, Molding - Dent - Medium / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Air Conditioner - Function - Weak / Battery - Weak - Yes / Horn - Issue - Yes / Seat Belts - Issue - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with spare key, with reverse camera, with incomplete tools &amp; jack, with warranty &amp; manual booklet, no spare tire, no sunlight visor, aircon not working.</p>