

General Information

Date & Time: 26, Nov, 2025 14:44

Make	Toyota	Model	Hilux
YOM	2021	Odo Meter Reading	28,932
Registration No.	NGB6331	Chassis No.	MR0JB8DD9L3533236
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Silver		

Body / Panel Condition



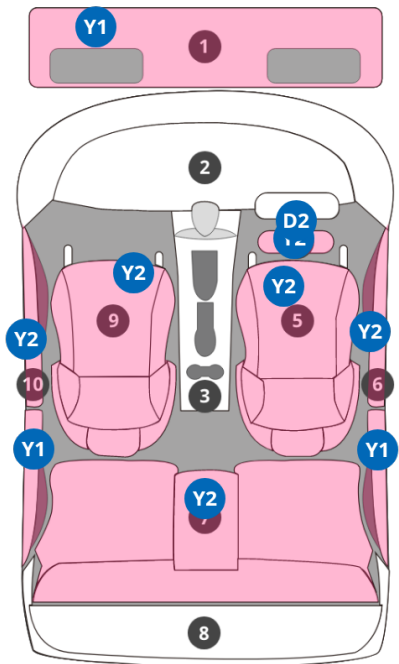
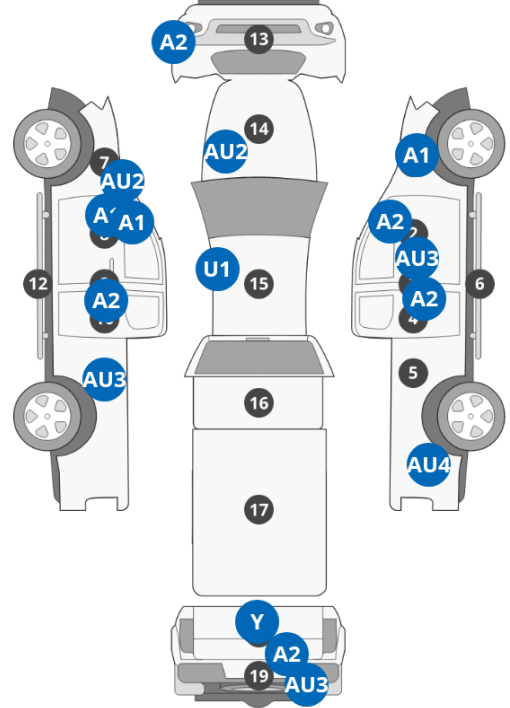
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.6	115	127	117
2	Boot Lid	105.0	108	104	103
3	Roof	118.0	123	116	118/115
4	Left Front Fender	121.0	148	108	107
5	Left Front Door	113.0	115	109	115
6	Center Panel Left				
7	Left Rear Door	106.1	115	105	99
8	Left Back Panel	115.0	99	115	131
9	Right Front Fender	193.0	129	219	231
10	Right Front Door	114.0	117	114	111
11	Center Panel Right				
12	Right Rear Door	105.0	101	105	109
13	Right Back Panel	117.6	127	117	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Mat Other - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Side Gate - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Rear Gate - Scratch - Small / (L) Side Gate - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / Antennae - Damaged - Yes / Roof - Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, no tools, with spare tire, with LTO plate, scratched and cracked tail light</p>