

General Information

Date & Time: 25, Nov, 2025 14:01

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	24,953
Registration No.	NFA9597	Chassis No.	PA1B18F3XP4232523
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



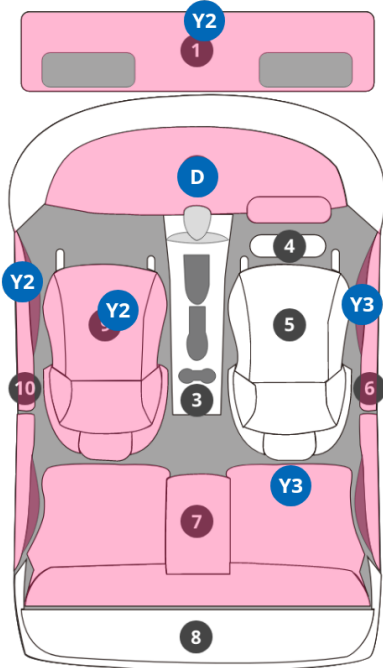
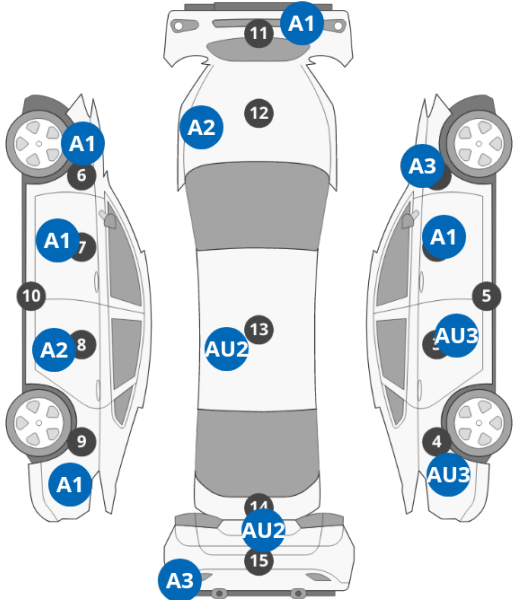
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.0	110	97	105
2	Boot Lid	97.1	96	95	101
3	Roof	89.3	87	91	84/96
4	Left Front Fender	92.2	91	92	94
5	Left Front Door	95.6	93	100	94
6	Center Panel Left				
7	Left Rear Door	99.7	103	96	100
8	Left Back Panel	101.4	106	99	100
9	Right Front Fender	96.8	101	89	101
10	Right Front Door	100.0	95	101	104
11	Center Panel Right				
12	Right Rear Door	101.0	113	92	99
13	Right Back Panel	103.2	97	98	114

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks Roof - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/No reverse camera/with jack and incomplete tools/with warranty booklet</p>