

## General Information

Date & Time: 25, Nov, 2025 13:48

<b>Make</b>	Toyota	<b>Model</b>	Raize
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	29,866
<b>Registration No.</b>	NHM1695	<b>Chassis No.</b>	MHKAA1BA9PJ106907
<b>CC</b>	1.0	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	White		

## Body / Panel Condition




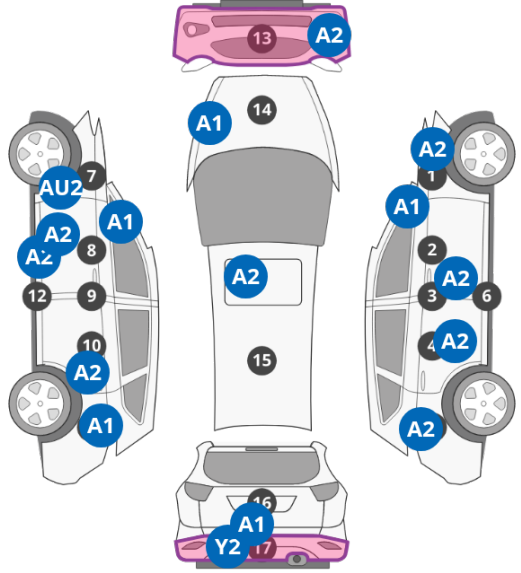
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	138.3	127	158	130
2	Boot Lid	120.0	115	135	110
3	Roof	102.5	104	107	81/118
4	Left Front Fender	122.3	120	131	116
5	Left Front Door	147.3	159	142	141
6	Center Panel Left				
7	Left Rear Door	140.0	142	134	144
8	Left Back Panel	109.0	111	103	113
9	Right Front Fender	137.0	130	150	131
10	Right Front Door	134.0	145	135	122
11	Center Panel Right				
12	Right Rear Door	121.9	92	124	150
13	Right Back Panel	110.3	109	110	112

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>
<div style="text-align: center; background-color: #cccccc; padding: 50px;">  <p>No Image</p> </div> <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Large / Overall Interior - Smell - Yes / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Crinkle - Small</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Crack, Gap - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light and headlight</p>