

General Information

Date & Time: 25, Nov, 2025 15:34

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	20,629
Registration No.	NKA2840	Chassis No.	PA1B18F32R4244054
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



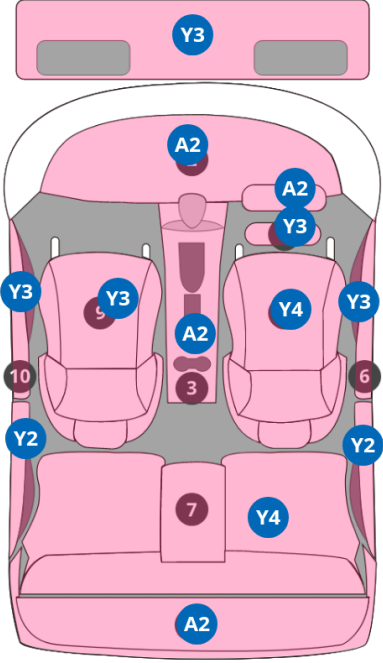
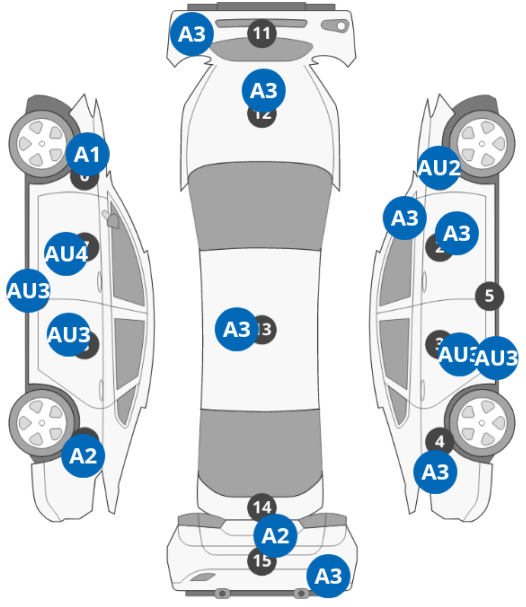
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	137	107	109
2	Boot Lid	105.3	100	107	109
3	Roof	95.3	99	99	90/95
4	Left Front Fender	95.7	98	93	96
5	Left Front Door	98.1	98	99	97
6	Center Panel Left				
7	Left Rear Door	101.1	105	99	100
8	Left Back Panel	107.0	118	101	102
9	Right Front Fender	104.6	111	100	103
10	Right Front Door	110.3	107	107	117
11	Center Panel Right				
12	Right Rear Door	103.6	100	105	106
13	Right Back Panel	105.0	103	101	111

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Large / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Large / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Small</p>	<p>Remarks (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/with jack and incomplete tools/No reverse camera/with warranty booklet/possible flooding/No fog light/interior dirty</p>