

## General Information

Date & Time: 25, Nov, 2025 18:27

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	12,114
<b>Registration No.</b>	DAQ4998	<b>Chassis No.</b>	MHKA4DF5FNJ068386
<b>CC</b>	1.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Orange		

## Body / Panel Condition



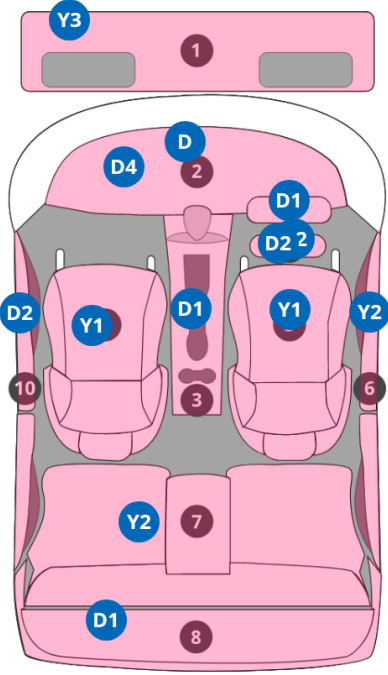
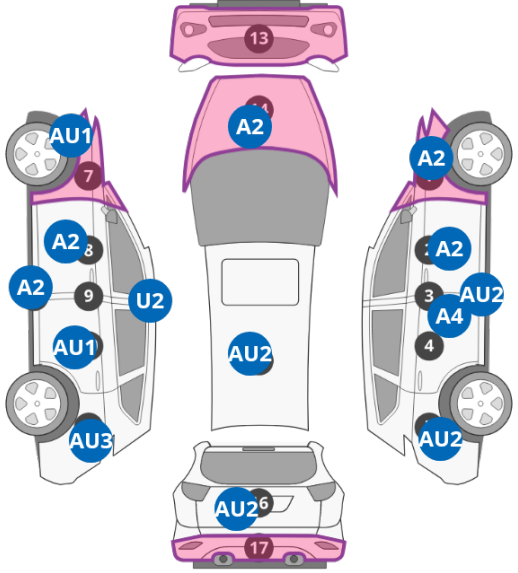
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	179.3	187	143	208
2	Boot Lid	101.0	98	106	99
3	Roof	87.0	71	89	100/88
4	Left Front Fender	153.3	179	140	141
5	Left Front Door	207.6	225	199	199
6	Center Panel Left				
7	Left Rear Door	109.4	111	98	119
8	Left Back Panel	110.3	113	113	105
9	Right Front Fender	158.6	173	175	128
10	Right Front Door	115.0	111	114	120
11	Center Panel Right				
12	Right Rear Door	94.8	106	89	89
13	Right Back Panel	103.6	98	113	100

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worked - Large / Glove Box - Worked - Minimal / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Rear Trim - Grime - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Console, Switches, Vents - Worked - Minimal / Rear Seat - Grime - Small / Trunk Room - Worked - Minimal</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch &amp; Dent - Minimal / Front Bumper, Grille, Lamps - Repair mark - Difference in Color / (L) Front Fender, Molding - Repair mark - Yes / Roof - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Center Panel - Dent - Small / Bonnet, Headlight - Repair mark - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with spare tire, no tools &amp; jack, issue on right side mirror, no warranty &amp; manual booklet, with reverse camera, no spare key, scratches on taillight.</p>