

General Information

Date & Time: 26, Nov, 2025 10:56

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	6,961
Registration No.	DBR2736	Chassis No.	PA1B18F39R4258484
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



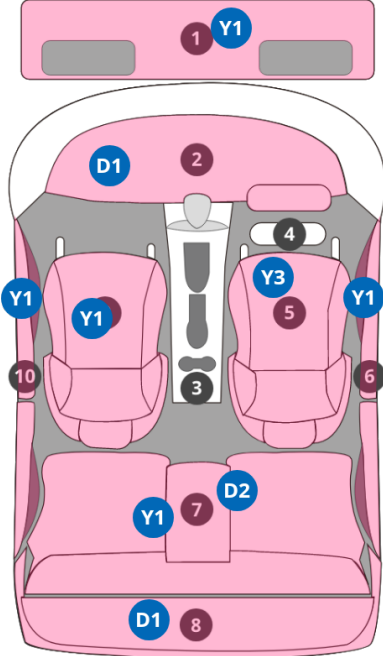
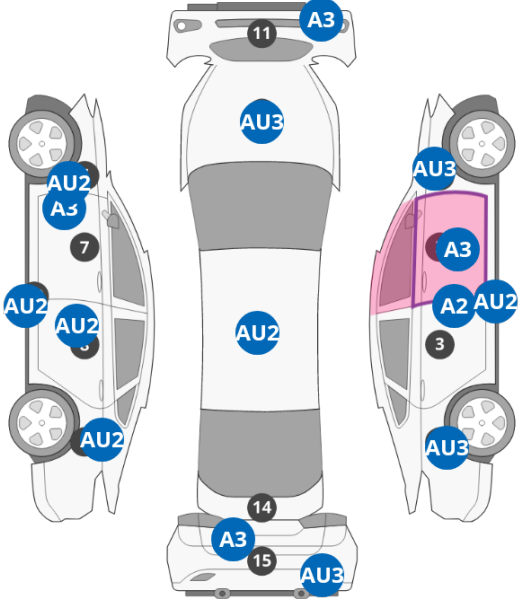
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.0	104	110	146
2	Boot Lid	113.0	111	115	113
3	Roof	105.0	104	112	102/102
4	Left Front Fender	102.6	105	100	103
5	Left Front Door	101.5	98	98	108
6	Center Panel Left				
7	Left Rear Door	110.6	102	111	119
8	Left Back Panel	115.3	125	115	106
9	Right Front Fender	106.6	114	96	110
10	Right Front Door	99.0	102	98	97
11	Center Panel Right				
12	Right Rear Door	107.3	100	111	111
13	Right Back Panel	110.7	93	103	136

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Minimal / Rear Seat Head Rest - Worked - Small / Rear Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Ceiling - Grime - Minimal / Trunk Room - Worked - Minimal / Dashboard - Worked - Minimal</p>	<p>Remarks (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with reverse camera, with spare tire, with incomplete tools & jack. with manual & warranty booklet, no spare key, scratches on taillight.</p>