

General Information

Date & Time: 26, Nov, 2025 08:36

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	803
Registration No.	DBS2396	Chassis No.	PA1B18F37R4280855
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



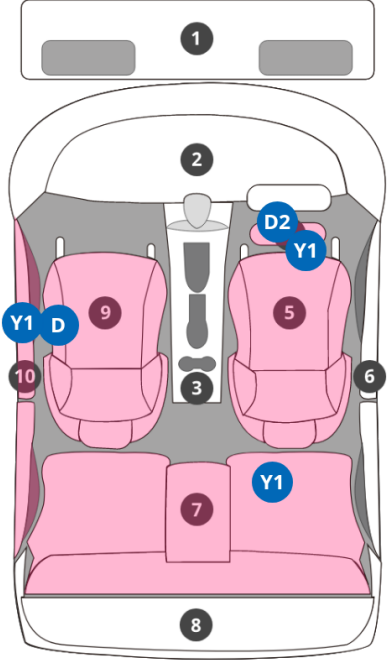
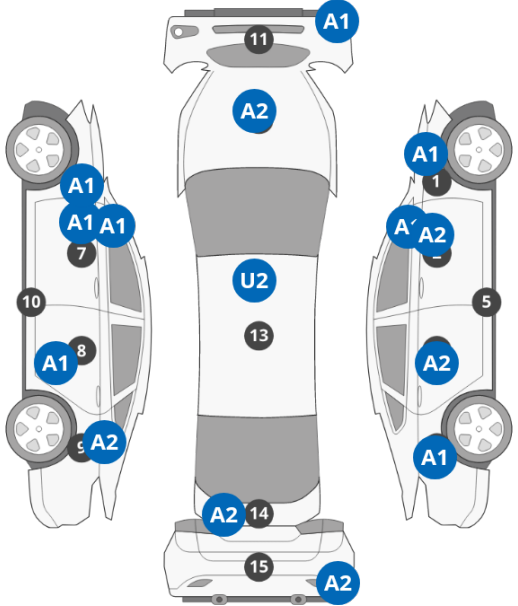
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.0	125	116	116
2	Boot Lid	107.6	105	107	111
3	Roof	116.5	121	121	108/116
4	Left Front Fender	105.2	110	100	106
5	Left Front Door	101.8	103	104	99
6	Center Panel Left				
7	Left Rear Door	106.0	113	105	100
8	Left Back Panel	111.6	117	112	106
9	Right Front Fender	110.3	117	102	112
10	Right Front Door	104.9	118	99	98
11	Center Panel Right				
12	Right Rear Door	109.0	110	102	115
13	Right Back Panel	117.6	133	105	115

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Minimal / Rear Seat - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with warranty booklet, jack, tools, spare tire and LTO PLATE, scratches on tail light</p>