

General Information

Date & Time: 25, Nov, 2025 16:55

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	22,378
Registration No.	NEY9670	Chassis No.	PA1B18F39R4262602
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



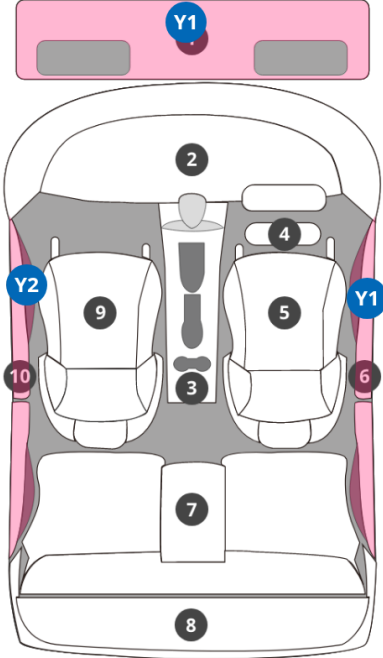
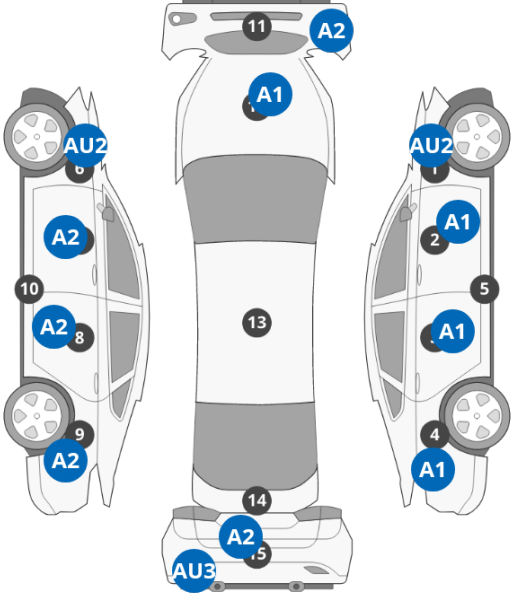
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.6	120	103	139
2	Boot Lid	104.3	102	101	110
3	Roof	94.8	103	98	88/91
4	Left Front Fender	99.0	100	96	101
5	Left Front Door	100.2	98	100	103
6	Center Panel Left				
7	Left Rear Door	102.4	113	102	92
8	Left Back Panel	111.0	122	104	107
9	Right Front Fender	100.2	101	98	102
10	Right Front Door	95.5	100	92	95
11	Center Panel Right				
12	Right Rear Door	99.4	98	96	104
13	Right Back Panel	94.2	91	88	104

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Ceiling - Grime - Minimal</p>	<p>Remarks Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/with reverse camera/No warranty booklet/front left side cheek light issue/No jack and incomplete tools</p>