

General Information

Date & Time: 25, Nov, 2025 15:49

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	8,572
Registration No.	NHM4709	Chassis No.	PA1B18F31R4243414
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



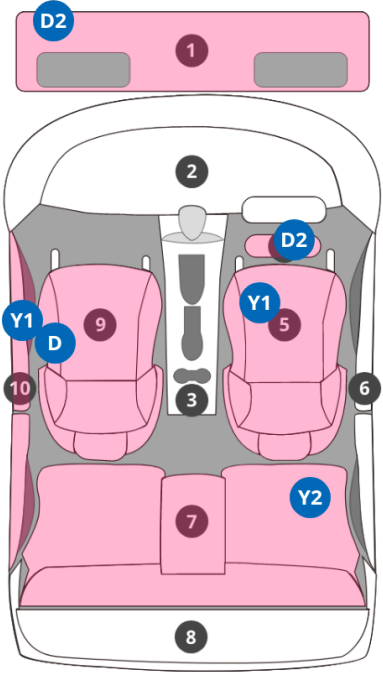
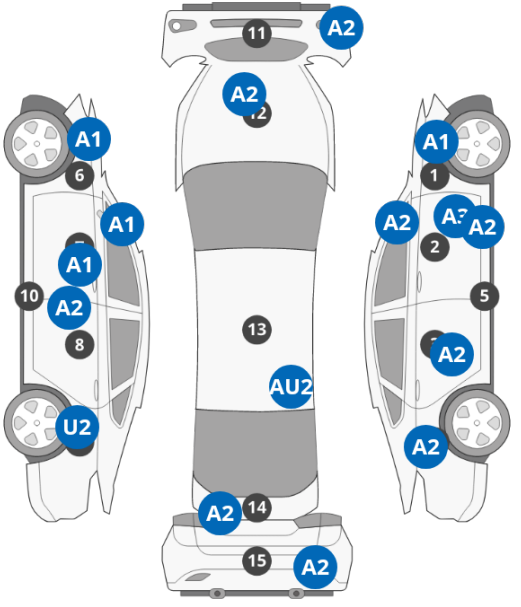
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.3	105	101	110
2	Boot Lid	104.3	101	106	106
3	Roof	101.2	110	99	94/102
4	Left Front Fender	95.6	91	97	99
5	Left Front Door	99.0	97	99	101
6	Center Panel Left				
7	Left Rear Door	102.3	106	105	96
8	Left Back Panel	104.1	107	107	99
9	Right Front Fender	103.0	110	101	98
10	Right Front Door	104.3	107	102	104
11	Center Panel Right				
12	Right Rear Door	104.7	104	97	113
13	Right Back Panel	106.6	106	104	110

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Minimal / Ceiling - Crinkle - Small / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Small</p>	<p>Remarks (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Roof - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, no tools, with spare tire, with LTO plate, scratches on tail light</p>