

General Information

Date & Time: 26, Nov, 2025 10:05

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	118,109
Registration No.	NDO3633	Chassis No.	PA1B18F35M4141140
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



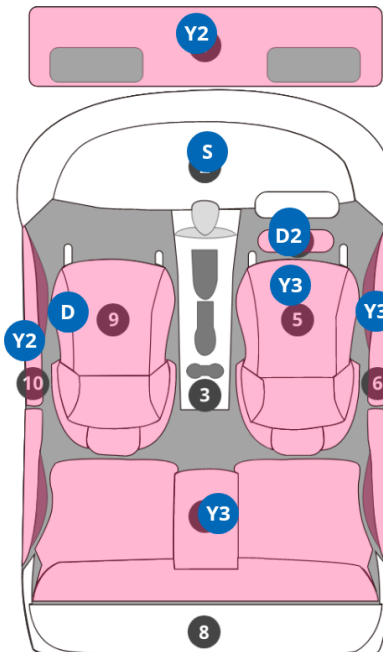
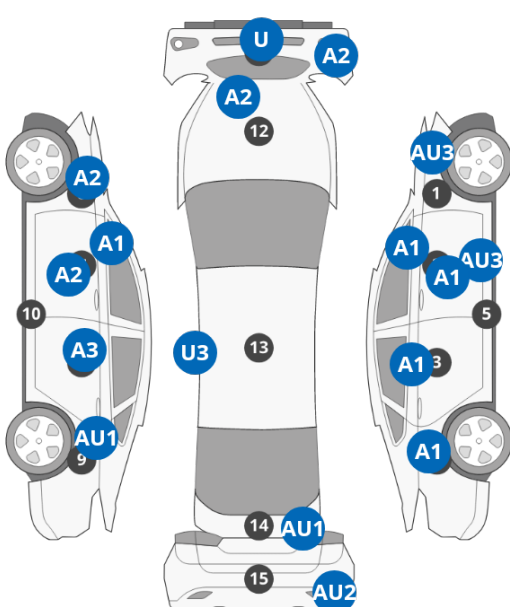
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	110	113	122
2	Boot Lid	114.6	116	111	117
3	Roof	104.1	108	111	99/98
4	Left Front Fender	97.3	97	98	97
5	Left Front Door	93.0	75	108	96
6	Center Panel Left				
7	Left Rear Door	100.2	103	100	98
8	Left Back Panel	110.3	116	107	108
9	Right Front Fender	94.3	94	93	96
10	Right Front Door	103.1	104	107	99
11	Center Panel Right				
12	Right Rear Door	101.6	96	100	109
13	Right Back Panel	101.4	99	99	107

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Floor Mat - Worked - Large / (R) Front Floor Mat - Worked - Small / Overall Interior - Worn as per age - Yes / Ceiling - Grime - Small / Overall Interior - Smell - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, possible, scratches on tail light</p>