

General Information

Date & Time: 26, Nov, 2025 15:34

Make	Mitsubishi	Model	Mirage
YOM	2023	Odo Meter Reading	91,175
Registration No.	NEE8788	Chassis No.	PAEA13TJPNA003001
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



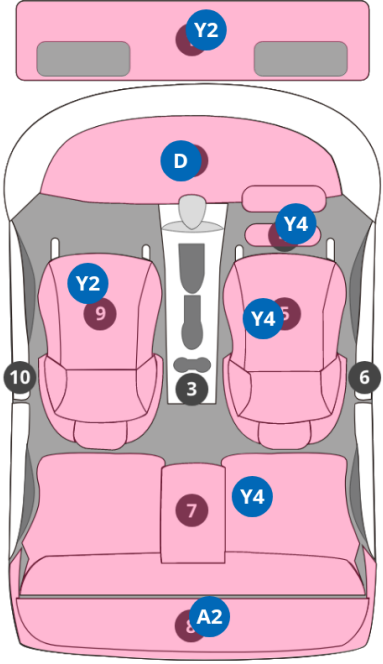
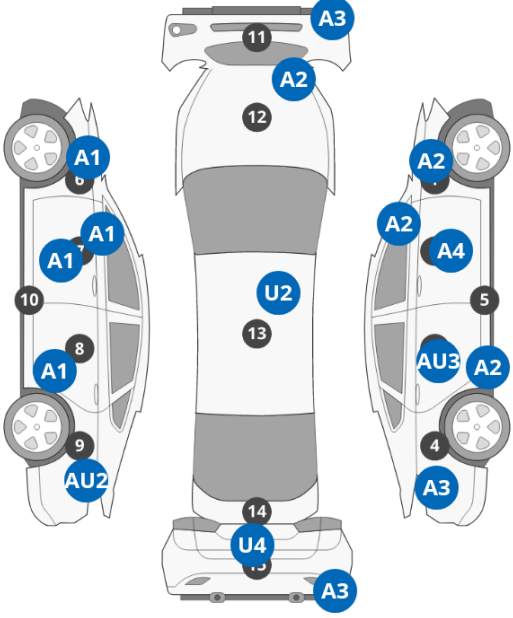
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	111	109	117
2	Boot Lid	109.6	101	115	113
3	Roof	108.7	109	112	106/108
4	Left Front Fender	114.6	120	111	113
5	Left Front Door	110.3	111	108	112
6	Center Panel Left				
7	Left Rear Door	110.3	118	105	108
8	Left Back Panel	116.6	121	116	113
9	Right Front Fender	119.0	125	106	126
10	Right Front Door	117.3	117	114	121
11	Center Panel Right				
12	Right Rear Door	107.6	107	103	113
13	Right Back Panel	108.6	106	107	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Large / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks Trunk Hood, Rear Gate - Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / Roof - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/No spare tire/No spare key/No reverse camera/No jack and tools/No warranty booklet/hazard issue/fog light issue/Interior dirty</p>