

General Information

Date & Time: 12, Jan, 2026 18:47

Make	Toyota	Model	Wigo
YOM	2022	Odo Meter Reading	48,456
Registration No.	NER7358	Chassis No.	MHKA4DF5FMJ064232
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



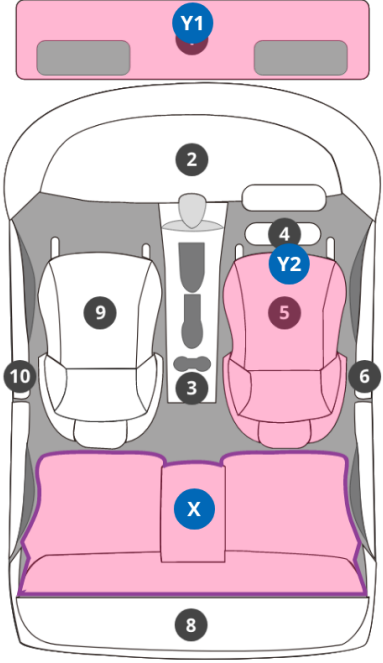
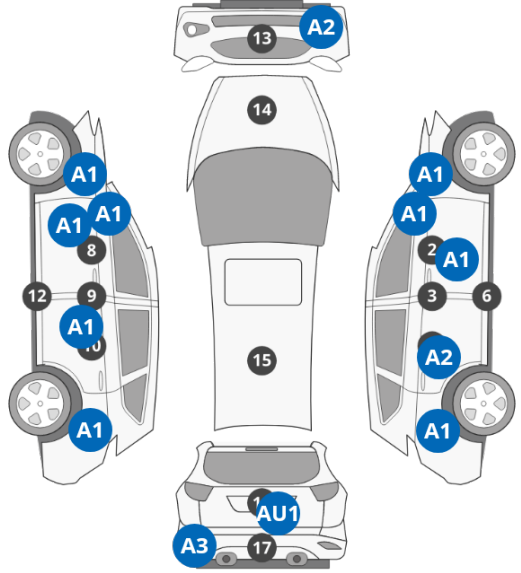
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.8	112	103	91
2	Boot Lid	96.3	100	97	93
3	Roof	87.9	78	94	92/89
4	Left Front Fender	99.4	92	105	101
5	Left Front Door	95.0	94	99	92
6	Center Panel Left				
7	Left Rear Door	96.8	93	102	96
8	Left Back Panel	94.0	91	97	94
9	Right Front Fender	99.9	97	104	99
10	Right Front Door	97.5	92	99	102
11	Center Panel Right				
12	Right Rear Door	95.9	98	99	92
13	Right Back Panel	92.4	83	95	100

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Minimal / (R) Front Seat - Grime - Small / Rear Seat Head Rest - Missing - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on headlights and taillights</p>