

General Information

Date & Time: 16, Feb, 2026 15:25

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	21,993
Registration No.	CCC1665	Chassis No.	PA1B18F32P4229714
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



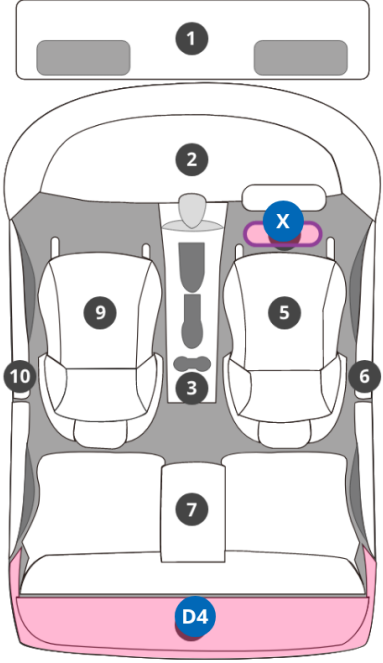
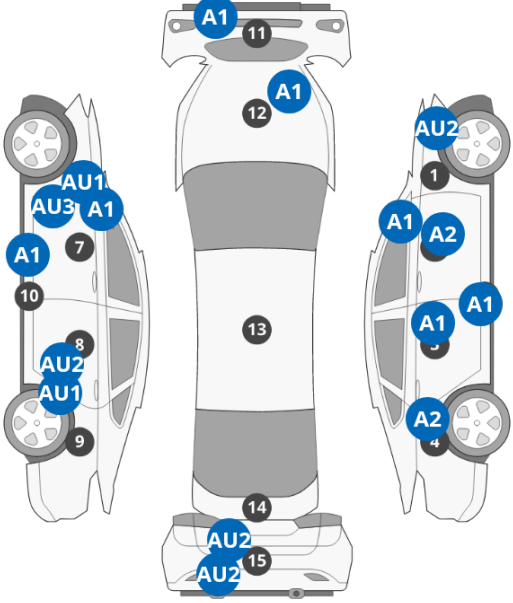
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	108	106	110
2	Boot Lid	121.0	124	107	132
3	Roof	94.7	96	90	97/96
4	Left Front Fender	107.3	102	113	107
5	Left Front Door	106.0	113	102	103
6	Center Panel Left				
7	Left Rear Door	105.3	110	106	100
8	Left Back Panel	109.0	109	107	111
9	Right Front Fender	95.5	100	92	95
10	Right Front Door	97.3	96	96	100
11	Center Panel Right				
12	Right Rear Door	102.9	114	97	98
13	Right Back Panel	110.0	105	106	119

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Missing - Yes / Trunk Room - Loose, Deformed - Large	Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Issue on Lto plate-Change plate,with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights, Crack taillight, trunk cover missing,