

General Information

Date & Time: 02, Dec, 2025 12:53

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	7,617
Registration No.	DBT1760	Chassis No.	PA1B18F3XS4283769
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



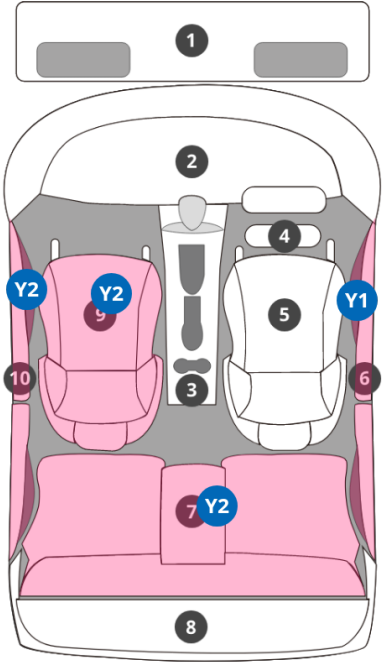
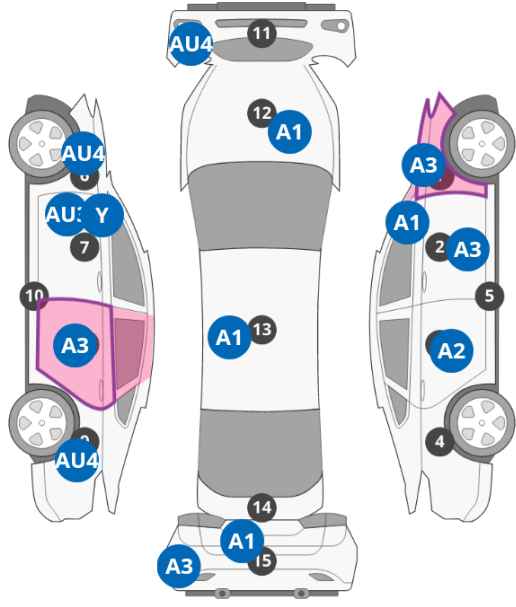
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	130	101	107
2	Boot Lid	102.9	100	101	108
3	Roof	100.5	103	97	95/107
4	Left Front Fender	96.4	96	97	97
5	Left Front Door	101.9	102	104	100
6	Center Panel Left				
7	Left Rear Door	208.3	142	314	169
8	Left Back Panel	104.6	109	109	96
9	Right Front Fender	315.6	235	364	348
10	Right Front Door	103.0	103	100	106
11	Center Panel Right				
12	Right Rear Door	104.0	104	99	109
13	Right Back Panel	107.1	96	100	125

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Rear Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch - Minimal / (L) Mirror - Crack - Damaged</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with spare key/with jack and incomplete tools/with reverse camera/with warranty booklet/fuel tank cover damage/left side mirror missing /Left side cheek light missing/left side front door issue</p>