

General Information

Date & Time: 02, Dec, 2025 12:56

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	2,562
Registration No.	NJQ1300	Chassis No.	MHKAA1BC4SJ036890
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



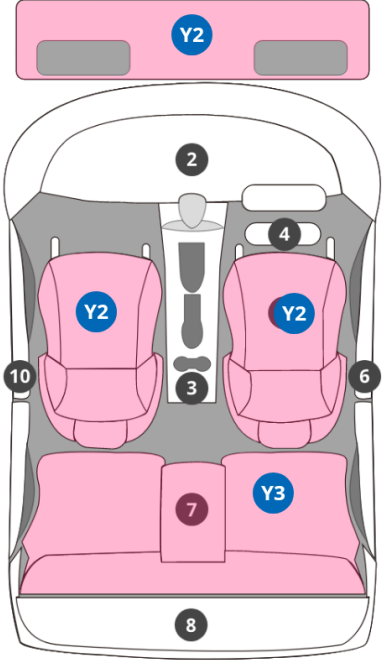
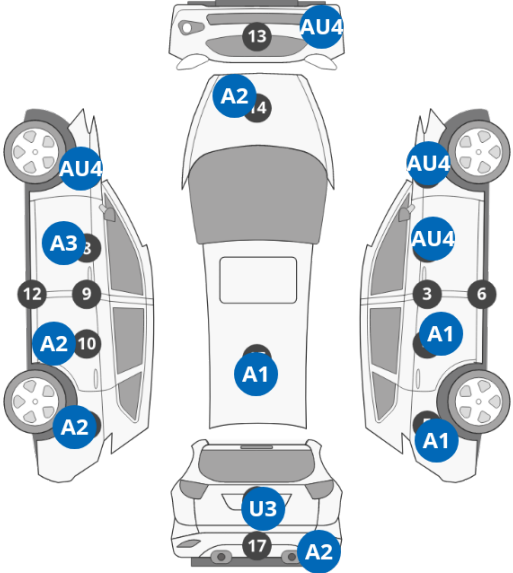
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	111	109	124
2	Boot Lid	100.2	101	94	106
3	Roof	100.4	105	95	106/96
4	Left Front Fender	111.0	120	108	105
5	Left Front Door	111.3	118	108	108
6	Center Panel Left				
7	Left Rear Door	111.0	123	103	107
8	Left Back Panel	106.6	100	111	109
9	Right Front Fender	110.0	112	107	111
10	Right Front Door	109.6	113	104	112
11	Center Panel Right				
12	Right Rear Door	109.0	116	102	109
13	Right Back Panel	102.3	97	104	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/with reverse camera/with jack No tools/No warranty booklets/fog light issue</p>