

General Information

Date & Time: 02, Dec, 2025 13:15

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	36,008
Registration No.	DBF5328	Chassis No.	PA1B18F31R4249813
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



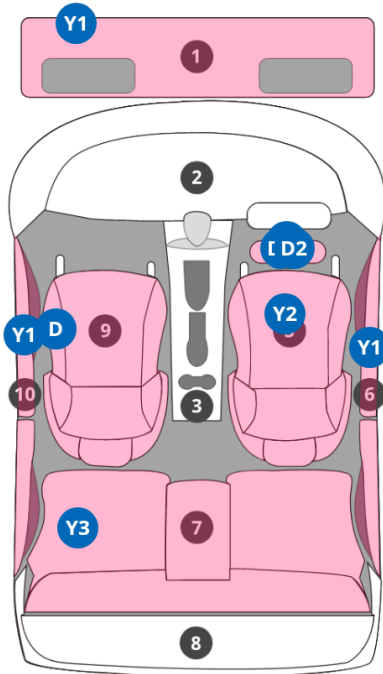
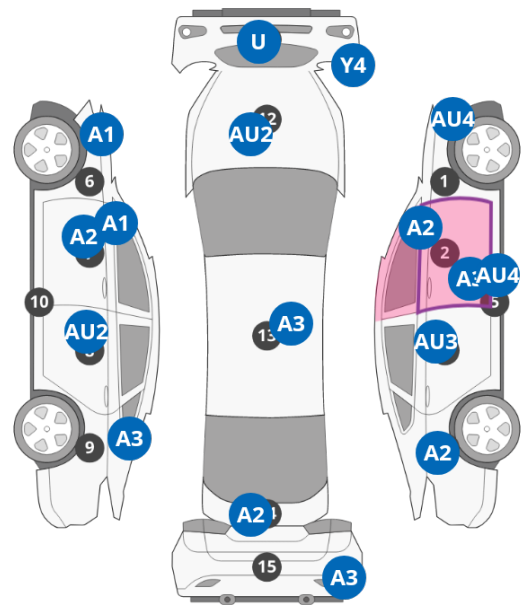
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	187.0	202	192	167
2	Boot Lid	114.3	111	116	116
3	Roof	105.7	111	109	96/107
4	Left Front Fender	98.8	101	96	100
5	Left Front Door	154.3	137	158	168
6	Center Panel Left				
7	Left Rear Door	220.3	271	197	193
8	Left Back Panel	126.0	160	108	110
9	Right Front Fender	92.7	100	87	91
10	Right Front Door	106.3	108	101	110
11	Center Panel Right				
12	Right Rear Door	112.3	109	116	112
13	Right Back Panel	113.3	112	113	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Floor Mat - Worked - Large / (R) Front Floor Mat - Worked - Large / (L) Front Seat - Worn - Yes / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / Ceiling - Grime - Minimal / (R) Front Seat - Grime - Small / Mat Other - Worked - Small</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light, fog lamp issue</p>