

## General Information

Date & Time: 03, Dec, 2025 08:41

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	13,651
<b>Registration No.</b>	NJC1409	<b>Chassis No.</b>	PA1B18F32S4285550
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



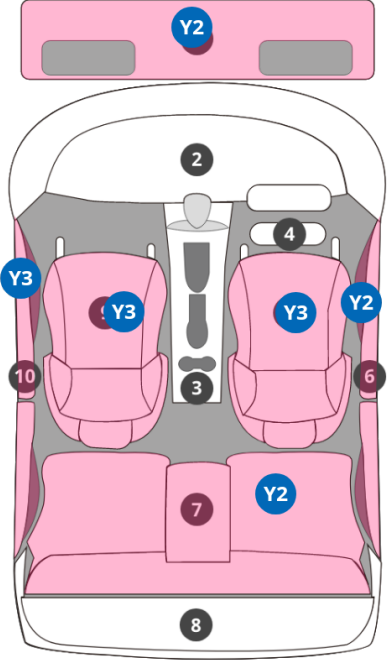
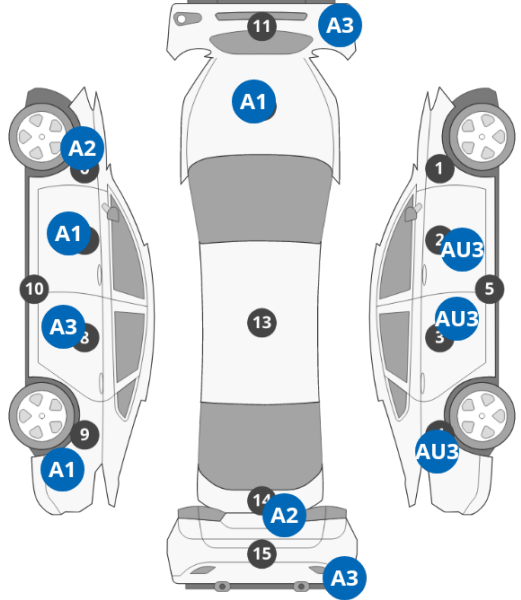
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	121	103	120
2	Boot Lid	103.6	104	103	104
3	Roof	93.6	95	91	95/93
4	Left Front Fender	97.2	99	95	97
5	Left Front Door	99.5	98	102	99
6	Center Panel Left				
7	Left Rear Door	97.2	100	97	95
8	Left Back Panel	107.0	111	109	101
9	Right Front Fender	99.8	99	99	102
10	Right Front Door	97.8	94	100	100
11	Center Panel Right				
12	Right Rear Door	101.5	106	100	99
13	Right Back Panel	100.6	92	95	115

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small</p>	<p><b>Remarks</b> (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/No spare key/wi5h jack and incomplete tools/with reverse camera/rear seat issue/with warranty booklet</p>