

General Information

Date & Time: 03, Dec, 2025 15:15

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	114,797
Registration No.	DAT9890	Chassis No.	PA1B18F33L4128921
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



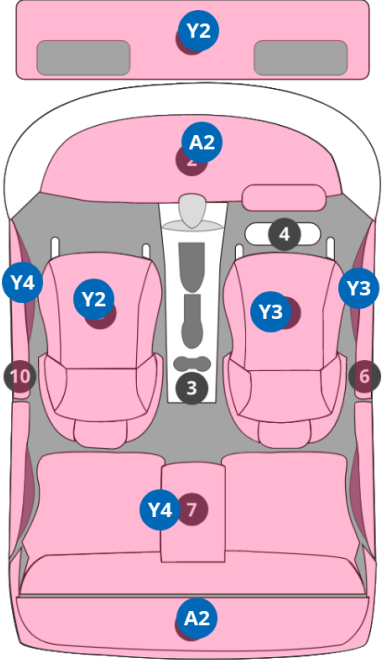
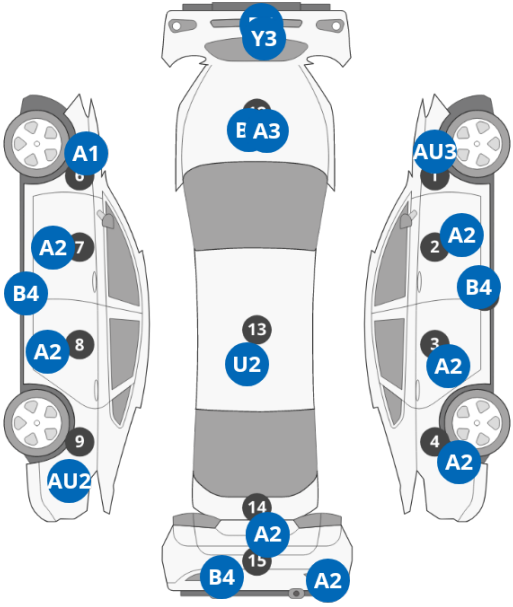
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	513.6	259	321	961
2	Boot Lid	102.0	104	100	102
3	Roof	184.7	200	190	191/158
4	Left Front Fender	92.6	88	97	94
5	Left Front Door	95.9	94	97	97
6	Center Panel Left				
7	Left Rear Door	81.2	77	84	83
8	Left Back Panel	108.6	110	107	109
9	Right Front Fender	95.9	97	97	94
10	Right Front Door	102.2	100	112	95
11	Center Panel Right				
12	Right Rear Door	97.2	91	95	106
13	Right Back Panel	159.6	191	148	140

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Bonnet, Headlight - Modified - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Modified - Large / Rear Bumper, Lamps, Panels - Modified - Large / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Modified - Large / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Modified - Large / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Modified - Large / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/No spare key/No spare tire/with jack No tools/reverse camera not working/No warranty booklet/front and back bumper modified/Roof repainted/open pipe modified/rear seat issue/interior dirty/front and rear door with stickers/trunk room dirty</p>