

General Information

Date & Time: 04, Dec, 2025 13:58

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	18,107
Registration No.	NEY6967	Chassis No.	PA2JA8EM0R0145225
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Blackish Red Mica		

Body / Panel Condition



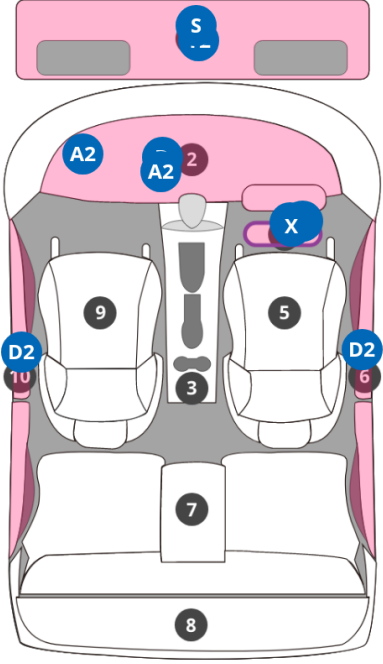
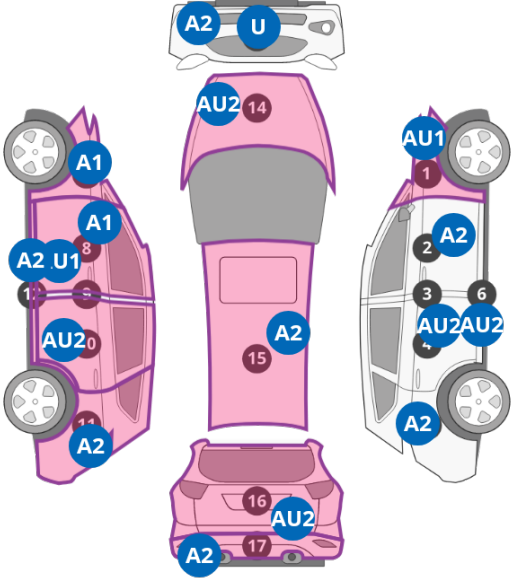
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	115	122	102
2	Boot Lid	112.0	121	109	106
3	Roof	95.2	92	91	99/99
4	Left Front Fender	68.4	68	71	66
5	Left Front Door	183.6	160	208	183
6	Center Panel Left				
7	Left Rear Door	186.0	218	201	139
8	Left Back Panel	217.6	242	222	189
9	Right Front Fender	101.4	97	107	100
10	Right Front Door	96.7	96	98	97
11	Center Panel Right				
12	Right Rear Door	97.8	96	98	100
13	Right Back Panel	100.1	99	101	100

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Steering Wheel - Worn, Peel, Crack - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Step - Replaced - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Replaced - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Roof - Repair mark - Yes / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Roof - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : D	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Condition of Welding ? - Yes / Left Center Pillar - Condition of Welding ? - Yes</p>	<p>Remarks Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes

With LTO plate and Spare tire and Jack, No Tools and warranty booklet, scratch headlight and tail light, Worn Tires and Spare tire, No spare key, foul smell, possible flooded.