

General Information

Date & Time: 05, Dec, 2025 15:48

Make	Toyota	Model	Vios
YOM	2019	Odo Meter Reading	64,710
Registration No.	DAJ2311	Chassis No.	PA1B18F3XJ4072167
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



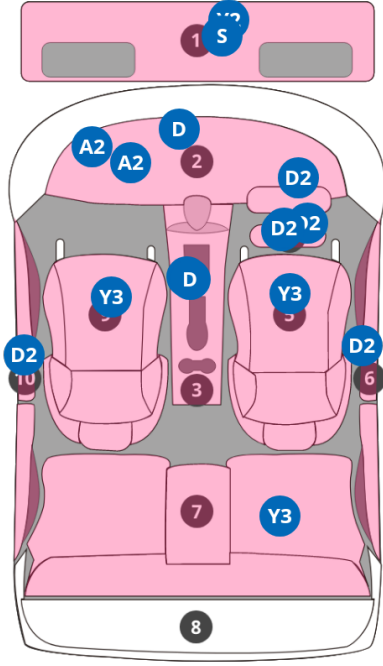
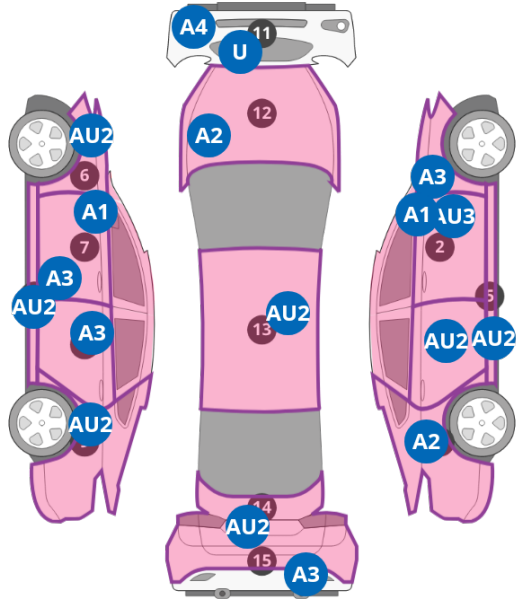
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.3	93	99	103
2	Boot Lid	113.3	110	111	119
3	Roof	88.9	91	90	82/93
4	Left Front Fender	94.8	97	94	94
5	Left Front Door	101.9	105	106	95
6	Center Panel Left				
7	Left Rear Door	194.6	244	204	136
8	Left Back Panel	287.6	340	226	297
9	Right Front Fender	474.6	737	338	349
10	Right Front Door	105.6	107	103	107
11	Center Panel Right				
12	Right Rear Door	110.6	111	107	114
13	Right Back Panel	108.0	109	102	113

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Steering Wheel - Worn, Peel, Crack - Small / Glove Box - Loose, Deformed - Small / Rear Seat - Grime - Medium / (R) Front Floor Mat - Worked - Small / Mat Other - Worked - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small / Overall Interior - Smell - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Difference in Color / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Roof - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Small
Frame Evaluation : C	Functional Evaluation : C
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate, Spare tire, No Tools and Jack, No Warranty booklet, No spare key, no reverse camera, scratch headlight and tail light, Worn Tires and Spare tire, foul smell, possible flooded, warning lamps on, Plate and room light issue, chief light issue.