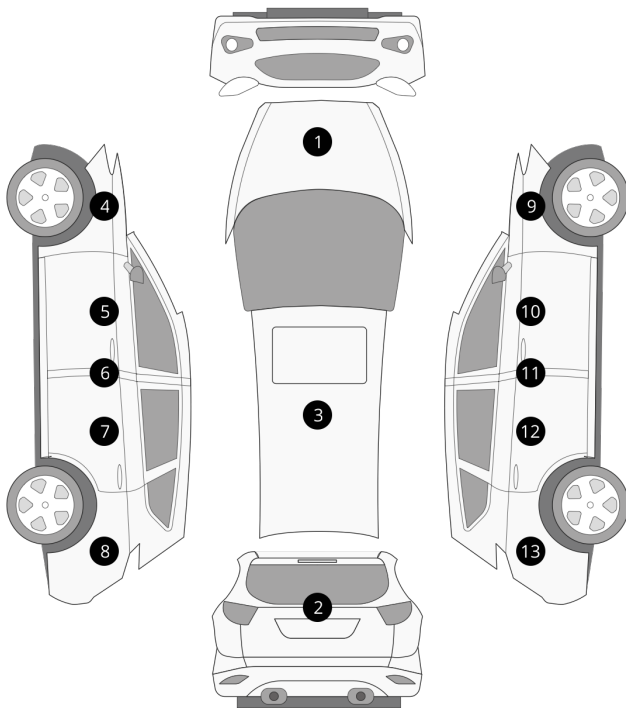


General Information

Date & Time: 10, Dec, 2025 10:19

Make	Nissan	Model	NV350
YOM	2018	Odo Meter Reading	79,010
Registration No.	NEA6691	Chassis No.	JNTC2E26Z0053817
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Black		

Body / Panel Condition



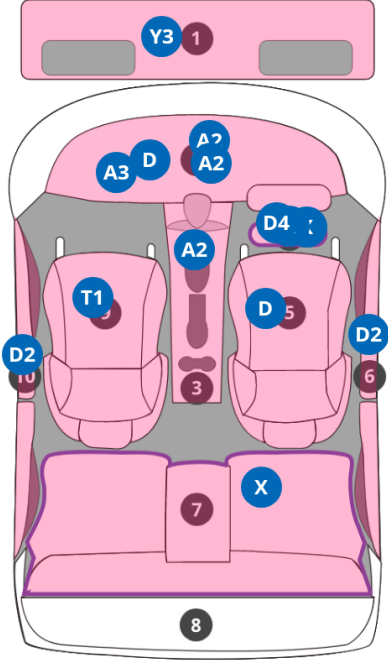
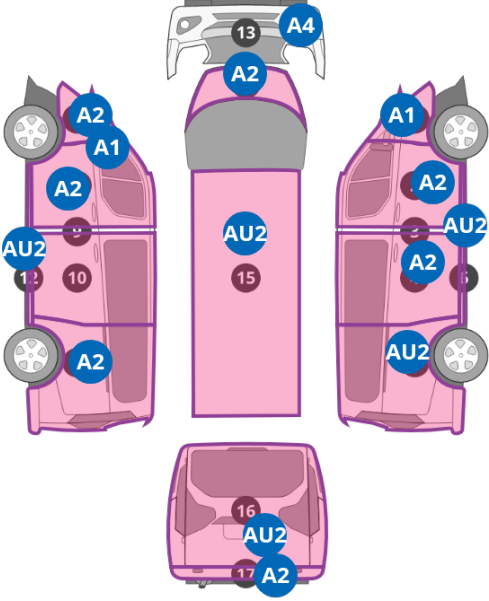
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	145.3	144	133	159
2	Boot Lid	102.6	96	116	96
3	Roof	89.7	76	85	101/96
4	Left Front Fender	148.6	171	144	131
5	Left Front Door	114.0	130	110	102
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	136.0	140	125	143
9	Right Front Fender	138.6	144	131	141
10	Right Front Door	174.0	194	164	164
11	Center Panel Right				
12	Right Rear Door	206.6	366	137	117
13	Right Back Panel	146.6	127	152	161

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Missing - Yes / Ceiling - Grime - Medium / (L) Front Seat - Cigarette Burns - Burnt Minimal / (R) Front Seat - Worn - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Glove Box - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Steering Wheel - Worn, Peel, Crack - Medium / Mat Other - Worked - Large</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / Front Panel - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Front Panel - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Door Lock - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes

With LTO plate and Spare tire, No Tools and Jack and Warranty booklet, No spare key, no reverse camera, foul smell, possible flooded, warning lamps on, headlight and tail light scratch and Crack, foglight issue, plate light issue and room light issue, air-conditioned issue, rear seat missing.