

## General Information

Date & Time: 10, Dec, 2025 10:20

<b>Make</b>	Mitsubishi	<b>Model</b>	Mirage
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	46,662
<b>Registration No.</b>	NGQ4052	<b>Chassis No.</b>	PAEA03RJNNA005043
<b>CC</b>	1.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Gray		

## Body / Panel Condition



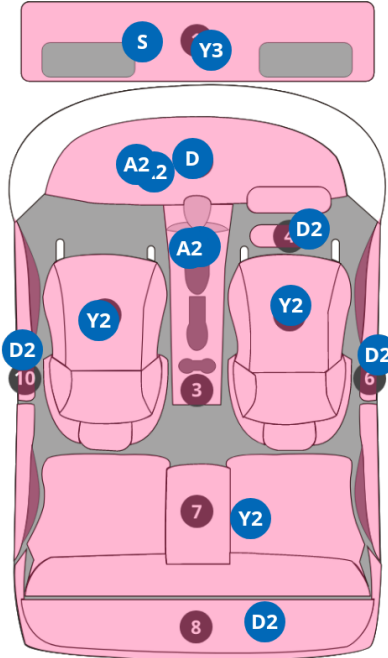
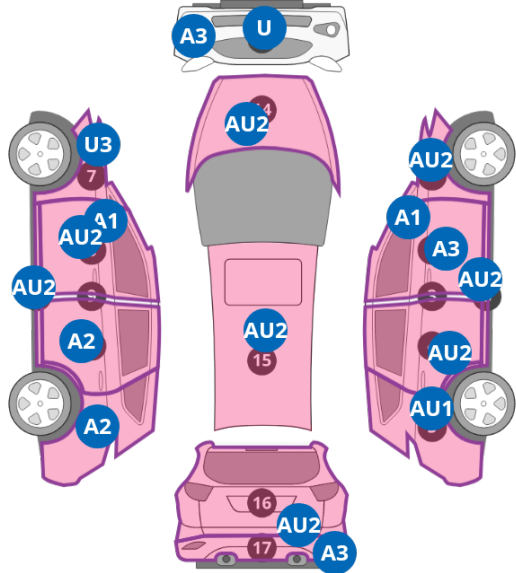
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	149.6	177	115	157
2	Boot Lid	102.3	106	101	100
3	Roof	123.8	159	100	139/97
4	Left Front Fender	431.0	415	517	361
5	Left Front Door	122.3	121	123	123
6	Center Panel Left				
7	Left Rear Door	103.9	100	108	104
8	Left Back Panel	124.6	124	115	135
9	Right Front Fender	183.3	291	140	119
10	Right Front Door	195.0	217	262	106
11	Center Panel Right				
12	Right Rear Door	357.3	160	734	178
13	Right Back Panel	578.6	206	533	997

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<p><b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span></p>	<p><b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">E</span></p>
<div style="text-align: center;">  </div> <p><b>a :</b> Cut, Fray <b>d :</b> Loose, Deformed <b>k :</b> Animal Hair <b>s :</b> Smell <b>t :</b> Cigarette Burns <b>x :</b> Defective <b>y :</b> Stain</p>	<div style="text-align: center;">  </div> <p><b>A :</b> Scratch <b>AU :</b> Scratch &amp; Dent <b>B :</b> Modified <b>C :</b> Corrosion <b>G :</b> Stone chip <b>P :</b> Faded <b>S :</b> Rust <b>SC :</b> Rust &amp; Corrosion <b>U :</b> Dent <b>X :</b> Defective <b>Y :</b> Crack, Gap</p>
<p><b>Remarks</b></p> <p>(L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Steering Wheel - Worn, Peel, Crack - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Room Mirror - Stuck - Yes / Ceiling - Grime - Medium / Overall Interior - Smell - Yes / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Trunk Room - Loose, Deformed - Small</p>	<p><b>Remarks</b></p> <p>(R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Step - Replaced - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Replaced - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Replaced - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Member (Bolted) - Dent - Yes / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Dent - Medium / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small</p>
<p><b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">D</span></p>	<p><b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">E</span></p>
<p><b>Remarks</b></p> <p>Right Front Pillar - Condition of Welding ? - Yes / Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Front Inside Panel (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Condition of Welding ? - Yes / Left Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b></p> <p>Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Door Lock - Issue - Yes / Shift Shock - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

**Inspector Notes**

With LTO plate and Spare tire and Jack, No Tools and warranty booklet, No spare key, worn tires and Spare tire, Scratch and Crack Tail light and Headlight, foglight issue, plate light issue and room light issue, air-conditioned issue, foul smell, No reverse camera.