

General Information

Date & Time: 09, Dec, 2025 10:06

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	86,404
Registration No.	DAQ8953	Chassis No.	PA1B18F37N4180491
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



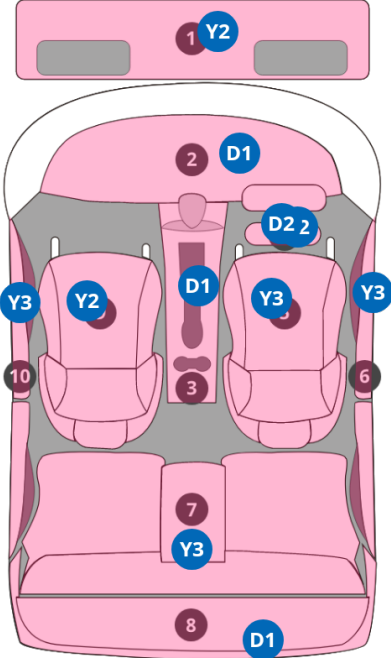
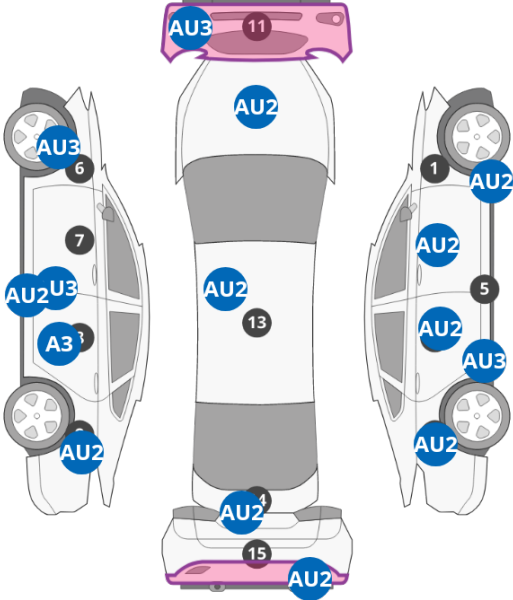
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	142	88	102
2	Boot Lid	142.0	150	141	135
3	Roof	92.6	100	90	91/90
4	Left Front Fender	97.7	96	99	98
5	Left Front Door	106.3	107	110	102
6	Center Panel Left				
7	Left Rear Door	99.8	105	90	104
8	Left Back Panel	109.5	120	109	100
9	Right Front Fender	98.9	106	95	96
10	Right Front Door	106.0	114	103	101
11	Center Panel Right				
12	Right Rear Door	112.6	100	131	107
13	Right Back Panel	112.7	97	131	110

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Medium / Trunk Room - Worked - Minimal / Ceiling - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small / Dashboard - Worked - Minimal / (L) Front Seat - Grime - Small / Console, Switchs, Vents - Worked - Minimal</p>	<p>Remarks (L) Step - Repair Traces - Yes / (L) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with incomplete tools & jack, no reverse camera, issue on fender liner, no warranty & manual booklet, scratches on taillight, no spare key.</p>