

General Information

Date & Time: 10, Dec, 2025 15:48

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	27,627
Registration No.	DBJ5601	Chassis No.	PA1B18F38P4224324
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



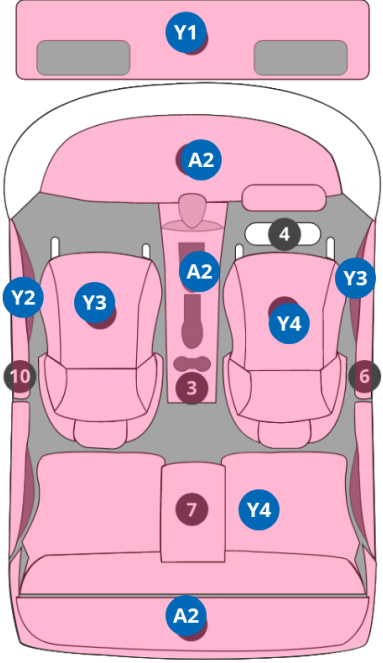
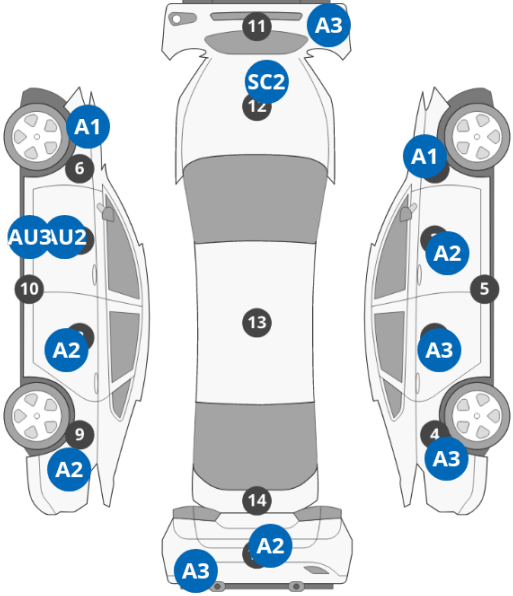
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	116	103	114
2	Boot Lid	103.8	107	99	106
3	Roof	95.9	95	100	93/96
4	Left Front Fender	102.4	100	99	108
5	Left Front Door	106.6	104	105	111
6	Center Panel Left				
7	Left Rear Door	109.0	110	102	115
8	Left Back Panel	117.3	137	106	109
9	Right Front Fender	105.3	109	102	105
10	Right Front Door	107.0	104	102	115
11	Center Panel Right				
12	Right Rear Door	107.6	111	107	105
13	Right Back Panel	108.9	100	103	124

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Large / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / Ceiling - Grime - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Bonnet, Headlight - Rust, Corrosion - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : E
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet/ No tools/ panel meter issue/ weak interior and exterior lights/ power window issue/ radio issue/ Horn issue/ ABS warning light/ Airbag warning light/ traction control light overheat warning light/ battery warning light/ power steering issue/ with jack and spare tire/ no LTO plate/</p>