

General Information

Date & Time: 10, Dec, 2025 14:48

Make	Toyota	Model	Wigo
YOM	2022	Odo Meter Reading	40,762
Registration No.	NFI9365	Chassis No.	MHKA4DF5FMJ064135
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



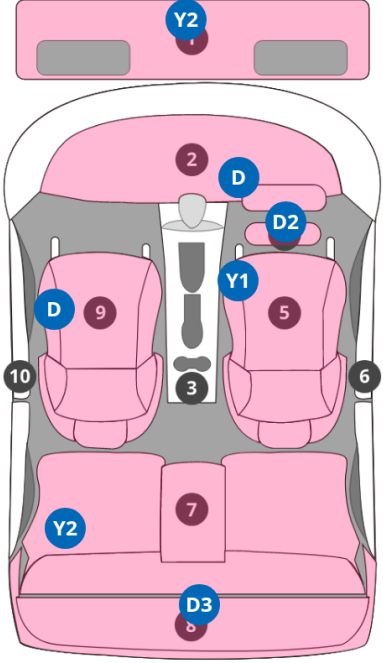
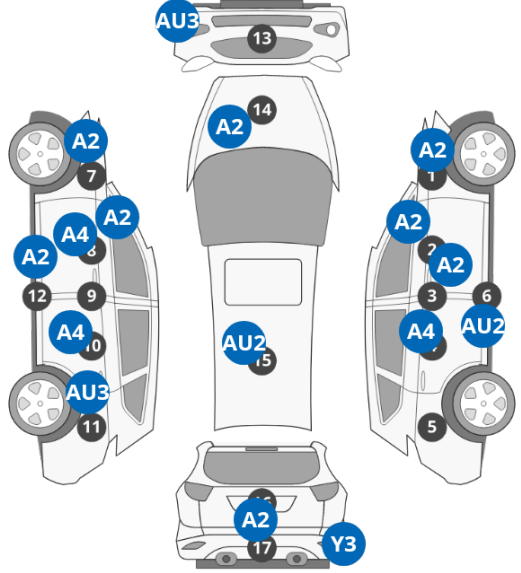
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.1	116	102	88
2	Boot Lid	94.8	86	100	99
3	Roof	102.1	109	99	98/103
4	Left Front Fender	93.5	86	105	90
5	Left Front Door	95.0	95	97	94
6	Center Panel Left				
7	Left Rear Door	95.4	93	96	98
8	Left Back Panel	86.2	87	87	85
9	Right Front Fender	100.5	101	113	88
10	Right Front Door	97.3	98	96	99
11	Center Panel Right				
12	Right Rear Door	94.8	106	96	82
13	Right Back Panel	163.0	161	166	162

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / Overall Interior - Worn as per age - Yes / Ceiling - Grime - Small / Trunk Room - Loose, Deformed - Medium / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, jack and tools, no spare tire, with LTO plate, scratches on headlight and tail light, plate light issue, cracked tail light</p>