

General Information

Date & Time: 10, Dec, 2025 15:06

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	100,849
Registration No.	VAA8183	Chassis No.	PA1B18F32L4125296
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



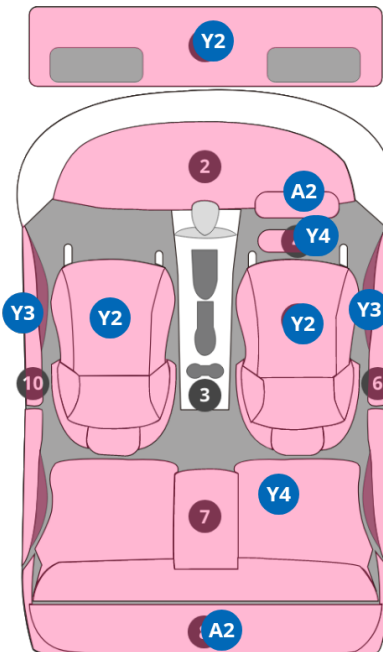
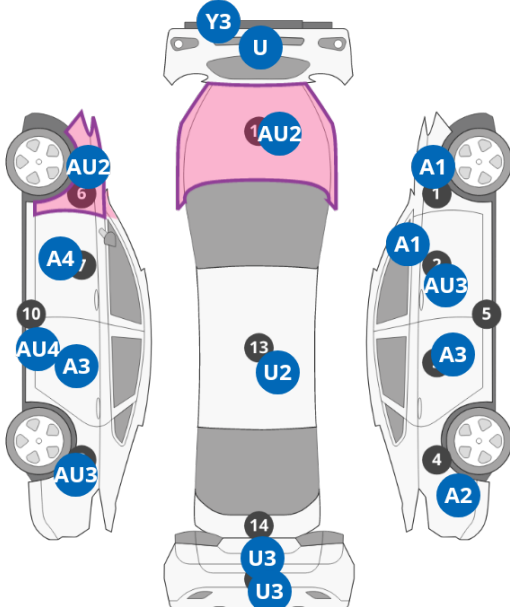
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	239.6	348	197	174
2	Boot Lid	101.3	103	100	101
3	Roof	89.3	94	85	87/92
4	Left Front Fender	419.3	343	520	395
5	Left Front Door	90.8	93	94	85
6	Center Panel Left				
7	Left Rear Door	91.5	93	90	91
8	Left Back Panel	106.3	113	108	98
9	Right Front Fender	152.6	133	163	162
10	Right Front Door	94.3	91	93	99
11	Center Panel Right				
12	Right Rear Door	91.6	90	91	93
13	Right Back Panel	97.9	93	96	105

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Large / Ceiling - Grime - Small / Steering Wheel - Worn, Peel, Crack - Small / (L) Front Seat - Grime - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Member (Bolted) - Dent - Yes / Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Dent - Medium / Roof - Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/ No spare key/trunk room carpet missing/No reverse camera/with warranty booklet/with jack and incomplete tools/possible flooding/engine noise vibration/interior dirty</p>