

General Information

Date & Time: 10, Dec, 2025 16:00

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	30,212
Registration No.	NFC9978	Chassis No.	MHFAA1BY0P0017177
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	MPV
Colour	White		

Body / Panel Condition



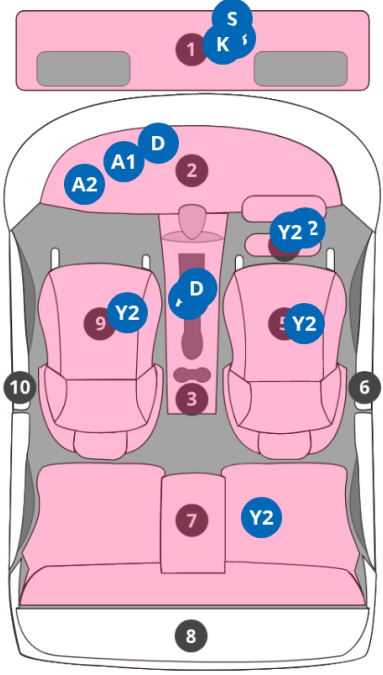
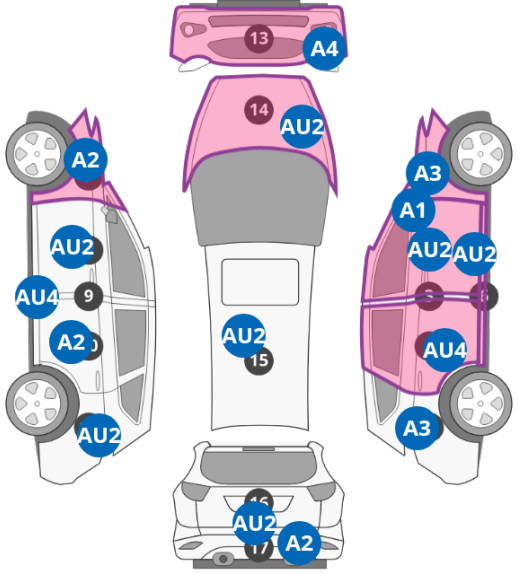
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	91.6	91	85	99
2	Boot Lid	88.6	92	89	84
3	Roof	97.1	85	96	100/108
4	Left Front Fender	95.3	94	97	95
5	Left Front Door	99.0	95	98	105
6	Center Panel Left				
7	Left Rear Door	99.5	102	96	101
8	Left Back Panel	98.3	105	104	86
9	Right Front Fender	92.0	94	93	89
10	Right Front Door	101.3	105	101	98
11	Center Panel Right				
12	Right Rear Door	100.2	100	102	99
13	Right Back Panel	98.6	88	109	99

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / (L) Front Floor Mat - Worked - Small / Mat Other - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Steering Wheel - Worn, Peel, Crack - Small / (R) Front Seat - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Front Door - Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : D	Functional Evaluation : D
<p>Remarks Right Front Pillar - Condition of Welding ? - Yes / Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Front Inside (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

Inspector Notes

With LTO plate and Jack, No Tools and Spare tire and warranty booklet, No reverse camera, scratch and crack tail light and headlight, worn tires, foul smell, possible flooded, warning lamps on, Aircon Blower issue, plate light issue and room light issue.