

General Information

Date & Time: 09, Dec, 2025 14:08

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	3,363
Registration No.	CAZ8645	Chassis No.	PA1B18F32R4238853
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



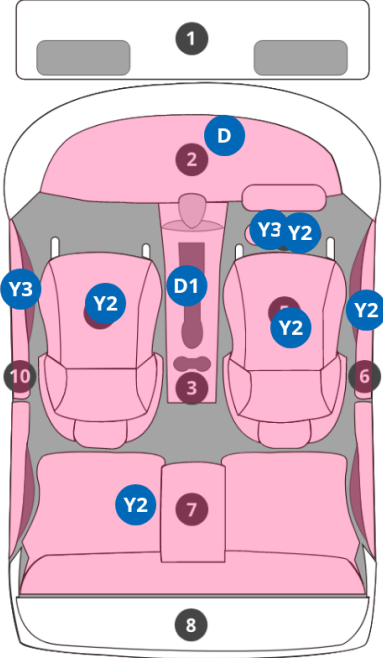
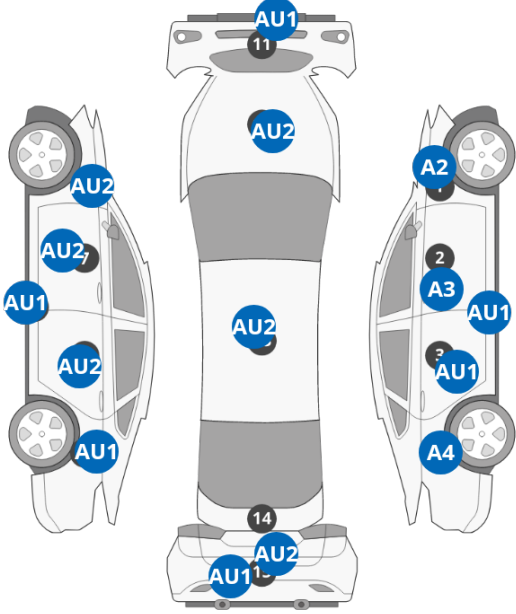
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.7	122	95	98
2	Boot Lid	101.3	100	102	102
3	Roof	104.1	115	107	97/98
4	Left Front Fender	97.1	98	91	103
5	Left Front Door	105.3	107	106	103
6	Center Panel Left				
7	Left Rear Door	105.9	102	100	116
8	Left Back Panel	108.6	120	108	98
9	Right Front Fender	100.1	102	97	101
10	Right Front Door	102.0	105	100	101
11	Center Panel Right				
12	Right Rear Door	105.0	106	104	105
13	Right Back Panel	112.5	100	111	127

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Console, Switchs, Vents - Worked - Minimal / (L) Front Trim - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / (R) Front Trim - Grime - Small</p>	<p>Remarks Roof - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : E
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with spare key, with incomplete tools & jack, with manual & warranty booklet, issue on headunit/radio, issue on idle, warning lamps indicator on, possible flooded, scratches on taillight, variant discrepancy on orcr (indicated on orcr XE variant).</p>