

General Information

Date & Time: 09, Dec, 2025 13:50

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	12,842
Registration No.	DBG7104	Chassis No.	PA1B18F36P4202547
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



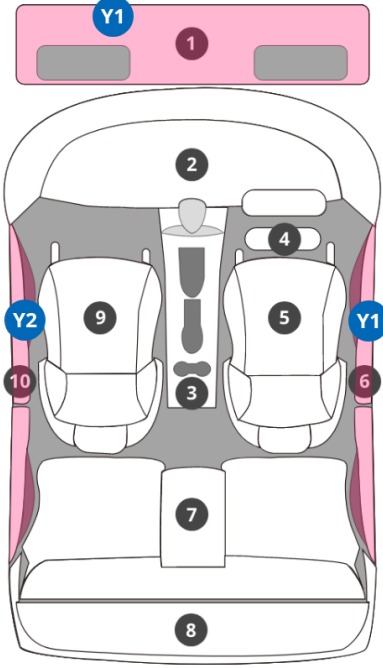
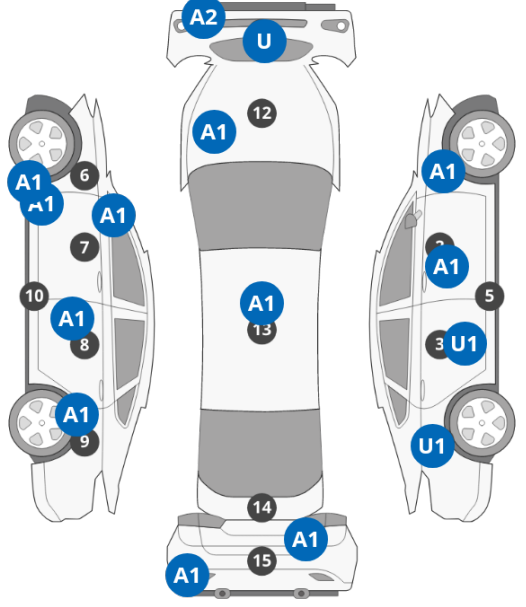
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.3	115	117	117
2	Boot Lid	108.0	102	109	113
3	Roof	100.0	113	99	93/96
4	Left Front Fender	105.6	101	106	110
5	Left Front Door	108.3	112	107	106
6	Center Panel Left				
7	Left Rear Door	106.2	111	108	100
8	Left Back Panel	124.3	120	111	142
9	Right Front Fender	99.1	100	94	104
10	Right Front Door	99.3	104	98	96
11	Center Panel Right				
12	Right Rear Door	101.3	96	99	109
13	Right Back Panel	105.3	108	101	107

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Dent - Minimal / (R) Rear Fender, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light</p>