

## General Information

Date & Time: 10, Dec, 2025 10:21

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2026	<b>Odo Meter Reading</b>	3,711
<b>Registration No.</b>	CDA4711	<b>Chassis No.</b>	PA1B18F31S4295227
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



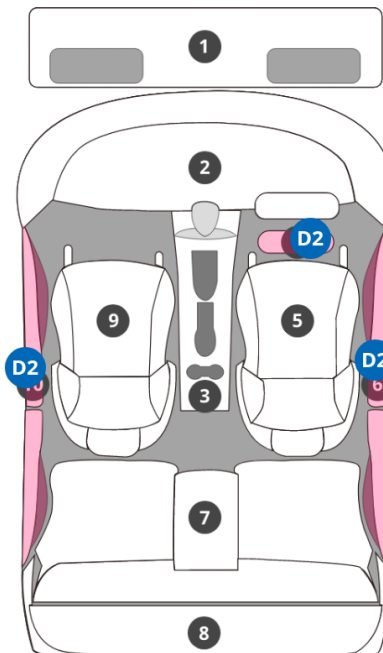
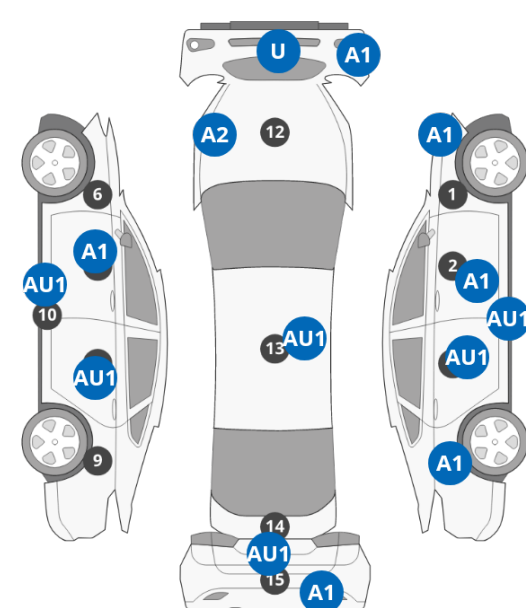
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	112	102	112
2	Boot Lid	103.3	96	109	105
3	Roof	95.3	92	89	99/102
4	Left Front Fender	100.3	104	98	99
5	Left Front Door	98.4	97	99	100
6	Center Panel Left				
7	Left Rear Door	96.7	100	100	90
8	Left Back Panel	111.6	111	111	113
9	Right Front Fender	104.3	107	100	106
10	Right Front Door	101.0	102	101	100
11	Center Panel Right				
12	Right Rear Door	103.7	96	101	114
13	Right Back Panel	102.4	101	95	111

Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Worked - Small / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Worked - Small</p>	<p><b>Remarks</b> Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch &amp; Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch &amp; Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch &amp; Dent - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Roof - Scratch &amp; Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Defects not found</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate and warranty booklet, No Sparetire and Jack and Tools, scratch headlight and tail light.</p>