

General Information

Date & Time: 10, Dec, 2025 09:05

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	11,488
Registration No.	BAH2467	Chassis No.	PA1B18F33S54283614
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



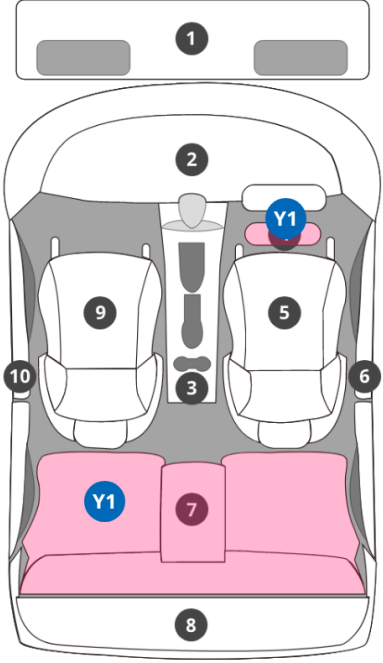
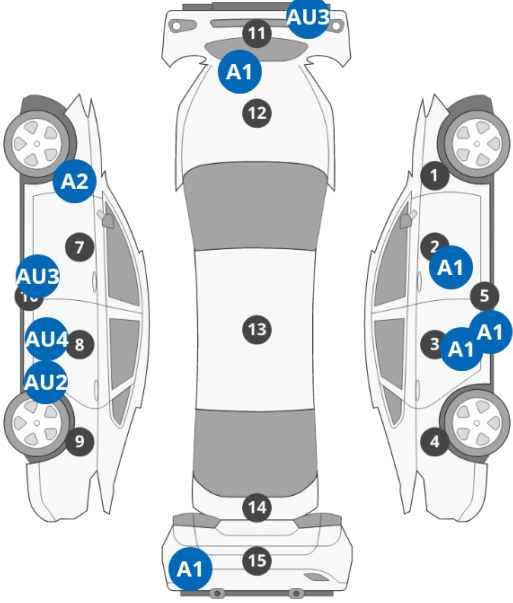
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	141.3	157	130	137
2	Boot Lid	100.0	94	99	107
3	Roof	91.6	97	90	84/96
4	Left Front Fender	97.3	104	91	97
5	Left Front Door	93.5	94	89	97
6	Center Panel Left				
7	Left Rear Door	101.6	106	100	99
8	Left Back Panel	98.0	99	97	99
9	Right Front Fender	91.4	94	84	96
10	Right Front Door	90.1	89	87	94
11	Center Panel Right				
12	Right Rear Door	100.1	99	98	103
13	Right Back Panel	98.1	93	99	103

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Grime - Minimal / Rear Seat - Grime - Minimal</p>	<p>Remarks Bonnet - Repair Traces - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, with spare tire, with jack and tools, 2keys, scratches on headlight</p>