

General Information

Date & Time: 10, Dec, 2025 09:05

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	6,238
Registration No.	CCQ1179	Chassis No.	PA1B18F3XS4289488
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



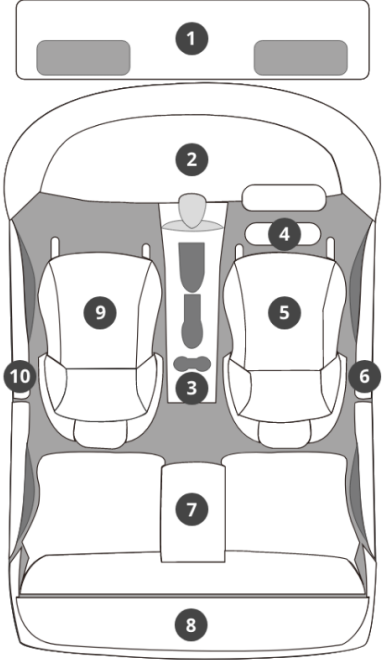
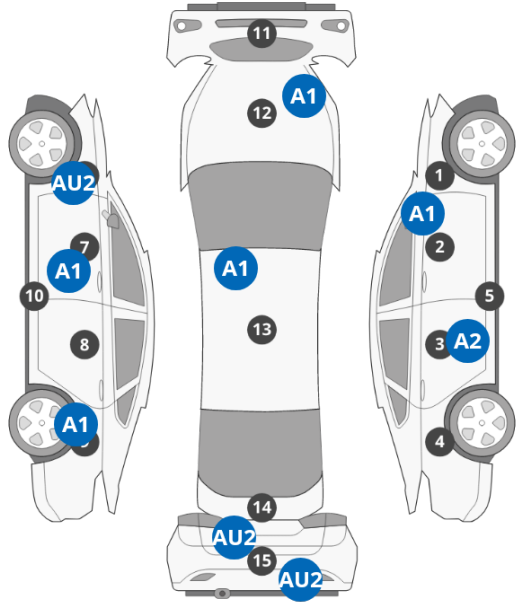
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	123	108	106
2	Boot Lid	105.3	103	104	109
3	Roof	110.2	117	101	106/117
4	Left Front Fender	104.3	105	102	106
5	Left Front Door	102.3	100	104	103
6	Center Panel Left				
7	Left Rear Door	109.0	109	113	105
8	Left Back Panel	109.0	113	105	109
9	Right Front Fender	105.8	110	109	99
10	Right Front Door	103.9	110	103	99
11	Center Panel Right				
12	Right Rear Door	111.3	105	109	120
13	Right Back Panel	106.6	104	105	111

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	A	Exterior Evaluation :	B
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Defects not found</p>		<p>Remarks (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal</p>	
Frame Evaluation :	A	Functional Evaluation :	B
<p>Remarks Defects not found</p>		<p>Remarks Battery - Weak - Yes</p>	

Inspector Notes
With Lto plate, with spare tire, 2keys, no warranty booklet, no jack and tools, scratches on headlight