

General Information

Date & Time: 10, Dec, 2025 10:39

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	68,556
Registration No.	NIG6065	Chassis No.	PA1B18F36N4195998
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



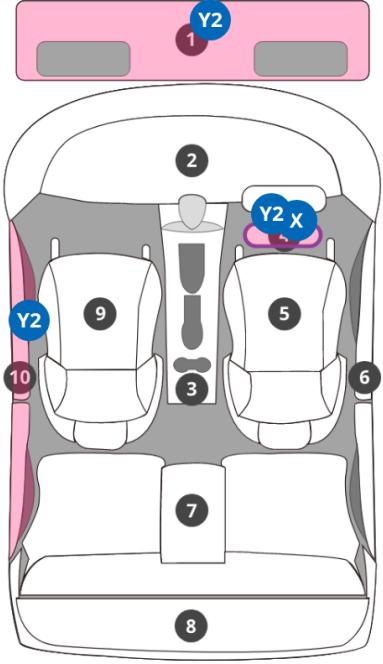
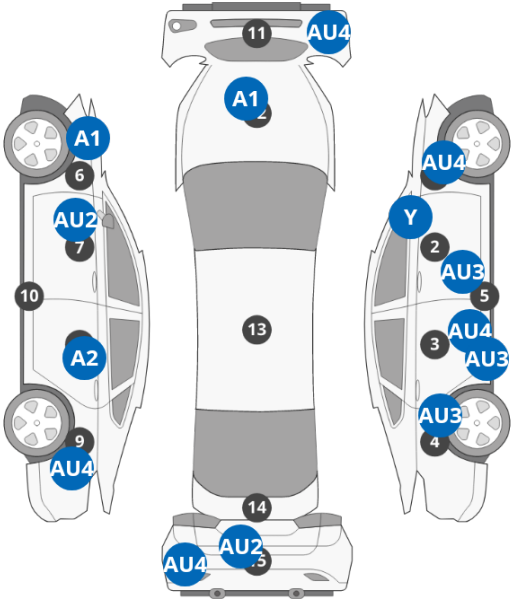
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.3	107	101	102
2	Boot Lid	70.2	74	64	73
3	Roof	91.9	99	92	87/91
4	Left Front Fender	93.9	96	88	99
5	Left Front Door	103.7	99	107	105
6	Center Panel Left				
7	Left Rear Door	100.5	105	98	99
8	Left Back Panel	101.9	108	96	102
9	Right Front Fender	96.8	101	95	94
10	Right Front Door	90.3	92	89	90
11	Center Panel Right				
12	Right Rear Door	93.3	89	90	102
13	Right Back Panel	94.1	95	90	97

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Mat Other - Missing - Yes / (L) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (R) Mirror - Crack - Damaged / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, 1key, no spare tire, no jack and tools, scratches on headlights,</p>