

General Information

Date & Time: 13, Dec, 2025 09:58

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	60,638
Registration No.	FAJ5598	Chassis No.	PA1B18F30N4179747
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



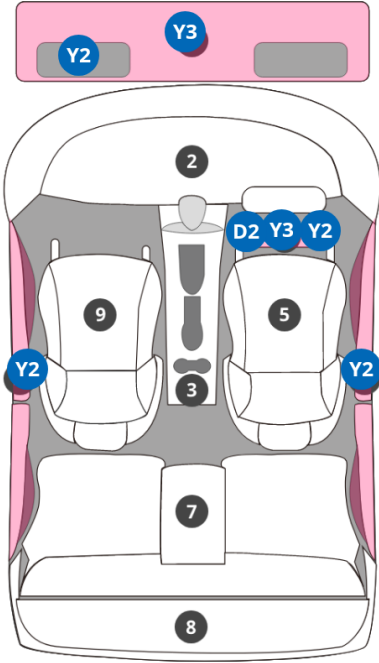
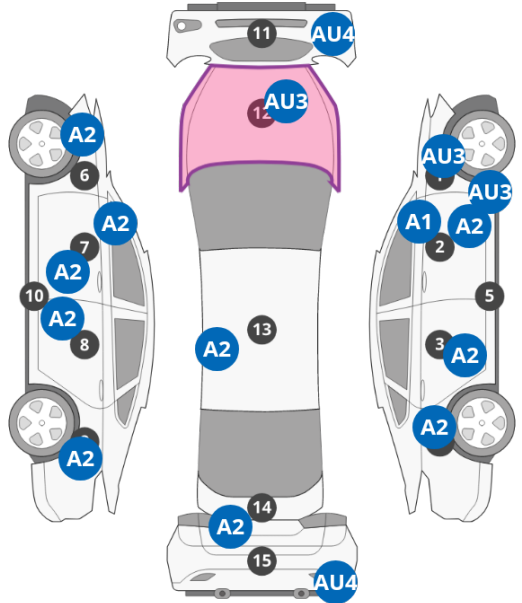
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	163.6	162	165	164
2	Boot Lid	110.6	105	109	118
3	Roof	100.2	111	98	100/92
4	Left Front Fender	101.1	106	99	98
5	Left Front Door	110.6	109	119	104
6	Center Panel Left				
7	Left Rear Door	109.0	113	108	106
8	Left Back Panel	113.0	122	111	106
9	Right Front Fender	101.0	103	100	100
10	Right Front Door	102.3	110	101	96
11	Center Panel Right				
12	Right Rear Door	100.5	96	97	108
13	Right Back Panel	105.2	104	99	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Roof - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Medium / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Hood repaired. Shifting not smooth. Without warranty booklet, spare tire, jack, and seat cover. Without tools. 1 key. With LTO plate. Crinkle at headliner.