

General Information

Date & Time: 13, Dec, 2025 14:59

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	41,799
Registration No.	GBE2210	Chassis No.	PA1B18F38R4246472
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



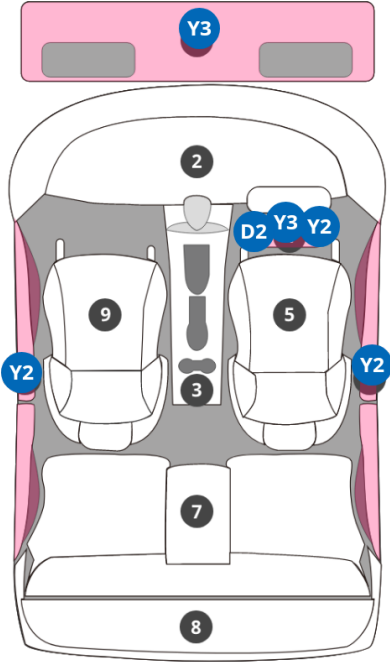
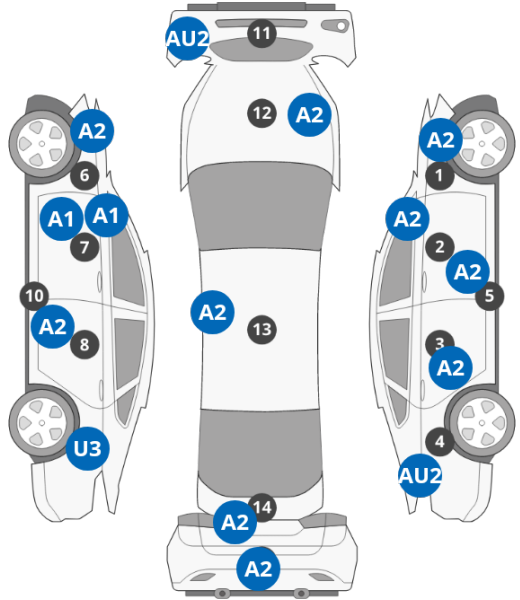
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	116	106	114
2	Boot Lid	111.0	111	110	112
3	Roof	104.3	105	98	108/107
4	Left Front Fender	96.8	99	92	100
5	Left Front Door	101.9	104	103	99
6	Center Panel Left				
7	Left Rear Door	112.3	120	112	105
8	Left Back Panel	110.3	115	108	108
9	Right Front Fender	106.0	105	109	104
10	Right Front Door	105.6	102	105	110
11	Center Panel Right				
12	Right Rear Door	139.0	145	141	131
13	Right Back Panel	111.6	111	109	115

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (L) Rear Fender, Molding - Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

Trunk floor partially missing. With warranty booklet, spare tire, jack and seat cover. Incomplete tools. 1 key. With LTO plate.