

General Information

Date & Time: 12, Dec, 2025 15:54

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	33,023
Registration No.	GBE4697	Chassis No.	PA1B18F3XR4250880
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



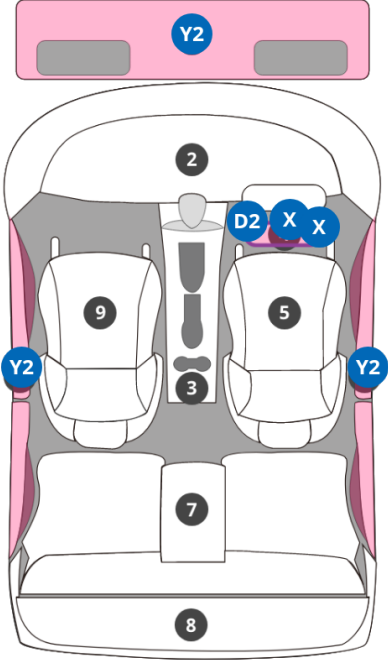
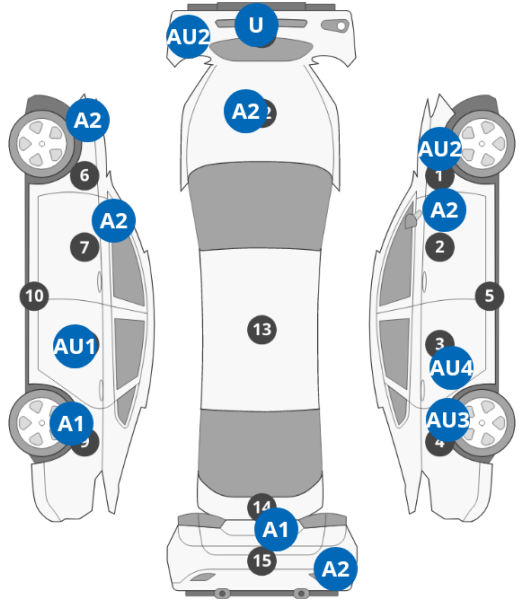
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	116	109	115
2	Boot Lid	112.6	107	115	116
3	Roof	103.8	114	94	100/108
4	Left Front Fender	100.2	104	97	100
5	Left Front Door	105.3	107	107	102
6	Center Panel Left				
7	Left Rear Door	114.6	127	115	102
8	Left Back Panel	111.0	118	110	105
9	Right Front Fender	109.3	108	112	108
10	Right Front Door	107.3	111	103	108
11	Center Panel Right				
12	Right Rear Door	115.6	106	113	128
13	Right Back Panel	114.6	112	110	122

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Mat Other - Missing - Yes / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Missing - Yes / Ceiling - Grime - Small / (R) Front Trim - Grime - Small</p>	<p>Remarks (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Small</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Possible flooding. Gap at front bumper. Without warranty booklet, spare tire, jack and tools. With seat cover. 1 key. With LTO plate.</p>