

General Information

Date & Time: 11, Dec, 2025 16:00

Make	Toyota	Model	Lite Ace
YOM	2025	Odo Meter Reading	38,639
Registration No.	CCG6659	Chassis No.	MHKU3FE10RK008962
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



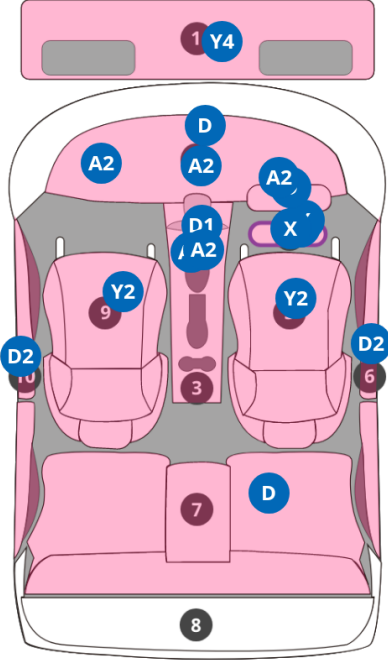
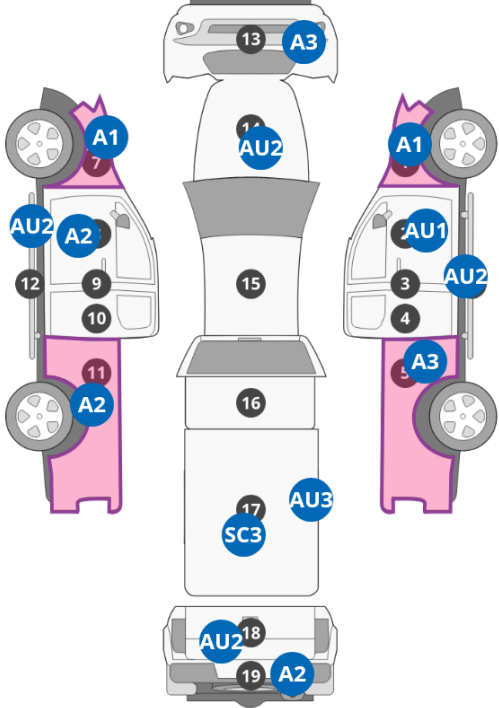
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	64.8	64	66	65
2	Boot Lid	122.0	142	112	112
3	Roof	79.5	49	67	84/118
4	Left Front Fender	66.0	66	62	70
5	Left Front Door	64.6	71	62	61
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	157.3	148	201	123
9	Right Front Fender	66.8	73	57	70
10	Right Front Door	57.3	62	58	53
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	192.6	110	361	107

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Steering Wheel - Worn, Peel, Crack - Small / Glove Box - Traces of Adhesive Tape - Yes / Glove Box - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Large / Rear Seat - Worn - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Worked - Minimal / Knobs - Worn, Peel, Crack - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small</p>	<p>Remarks (L) Rear Corner Panel - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Side Gate - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Medium / (R) Front Wheel, Cover - Cap Missing - Yes / (R) Rear Wheel, Cover - Cap Missing - Yes / (L) Rear Wheel, Cover - Cap Missing - Yes / (L) Front Wheel, Cover - Cap Missing - Yes / Roof - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch & Dent - Small / (L) Side Gate - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Cargo Bed Floor - Rust, Corrosion - Medium</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Spare tire and Warranty booklet, No Tools and Jack, No Spare key, no reverse camera, foul smell, worn tires and Spare tire, Scratch headlight and tail light, Plate light and Room light issue, Air-conditioned issue.</p>