

General Information

Date & Time: 11, Dec, 2025 16:01

Make	Toyota	Model	Hiace
YOM	2020	Odo Meter Reading	63,747
Registration No.	DAZ5731	Chassis No.	JTFJ02P4K5022988
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



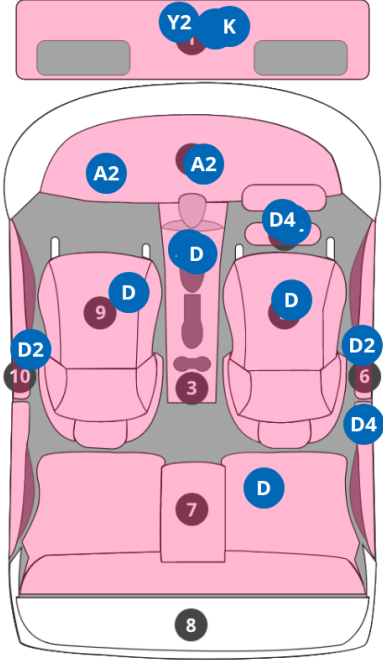
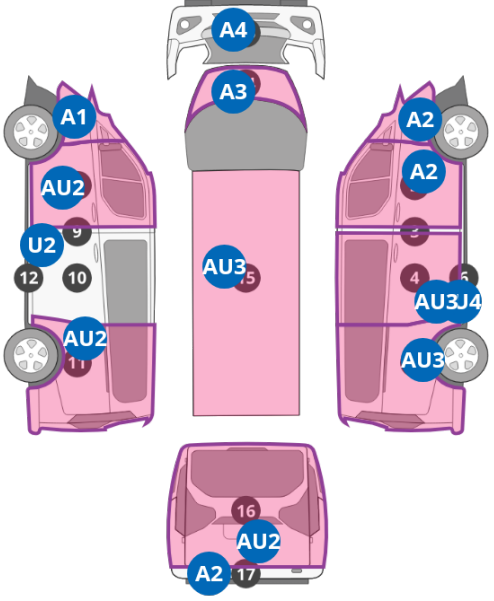
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	248.3	106	76	563
2	Boot Lid	125.6	122	126	129
3	Roof	76.9	93	67	59/88
4	Left Front Fender	220.0	338	163	159
5	Left Front Door	114.3	112	118	113
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	137.3	129	143	140
9	Right Front Fender	159.6	187	149	143
10	Right Front Door	131.6	113	131	151
11	Center Panel Right				
12	Right Rear Door	122.3	121	119	127
13	Right Back Panel	618.0	208	730	916

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Mat Other - Worked - Small / (R) Rear Trim - Worked - Large / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / (R) Front Trim - Worked - Small / (L) Front Trim - Worked - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / Rear Seat - Worn - Yes / (L) Front Floor Mat - Worked - Large / Steering Wheel - Worn, Peel, Crack - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Replaced - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Replaced - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch & Dent - Medium</p>
Frame Evaluation : D	Functional Evaluation : C
<p>Remarks Right Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Rear Side Member & Trunk Room Floor - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Door Lock - Issue - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes

With LTO plate in front and temporary plate in rear, with Sparetire, Scratch headlight and tail light crack, no spare key, worn tires and Sparetire, No Tools and Jack and Warranty booklet.