

General Information

Date & Time: 12, Dec, 2025 15:36

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	24,279
Registration No.	DBU3364	Chassis No.	PAHACACA4S421876
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Dropside
Colour	White		

Body / Panel Condition



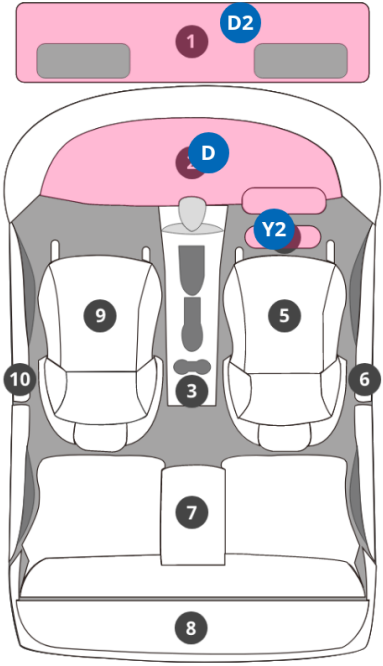
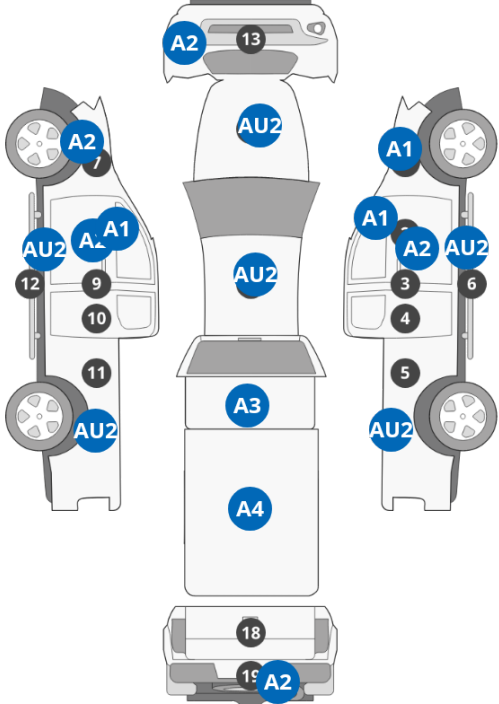
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.5	100	108	109
2	Boot Lid	47.5	49	42	51
3	Roof	115.2	115	112	104/130
4	Left Front Fender	100.3	104	100	97
5	Left Front Door	99.8	96	104	100
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	64.1	56	88	48
9	Right Front Fender	98.8	97	97	102
10	Right Front Door	99.7	97	100	102
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	66.1	67	66	65

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Crinkle - Small</p>	<p>Remarks (L) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Small / (L) Side Gate - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Cargo Bed Floor - Scratch - Large / Cab Back Panel - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet, No spare key, worn tires and Sparetire, No reverse camera, foul smell, Scratch Headlight and tail light.</p>