

## General Information

Date & Time: 11, Dec, 2025 15:55

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	24,585
<b>Registration No.</b>	CCG4652	<b>Chassis No.</b>	MHKAA1BC9RJ024809
<b>CC</b>	1.0	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Gray		

## Body / Panel Condition



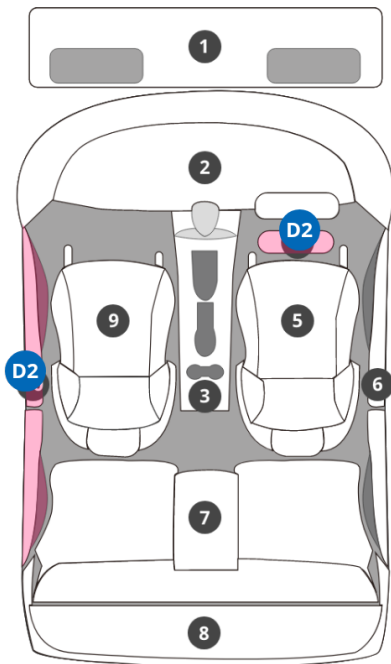
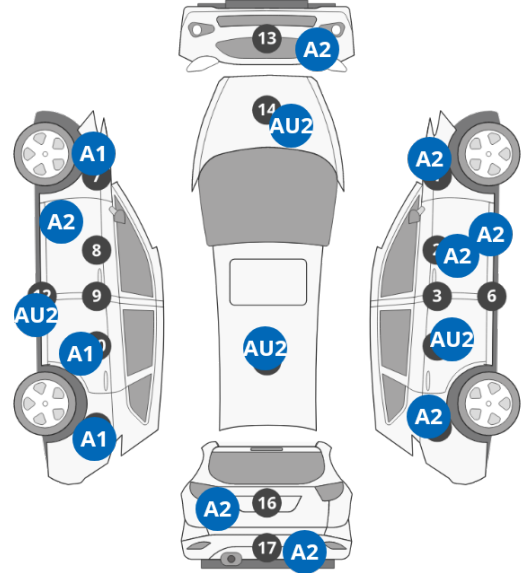
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.2	109	108	96
2	Boot Lid	82.8	78	86	85
3	Roof	74.2	71	77	73/76
4	Left Front Fender	90.6	88	92	92
5	Left Front Door	108.6	106	106	114
6	Center Panel Left				
7	Left Rear Door	101.4	110	101	93
8	Left Back Panel	85.6	89	88	80
9	Right Front Fender	94.7	96	106	82
10	Right Front Door	103.9	112	103	97
11	Center Panel Right				
12	Right Rear Door	108.0	104	103	117
13	Right Back Panel	91.3	90	94	90

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-size: 1.5em; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-size: 1.5em; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small</p>	<p><b>Remarks</b> Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Roof - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="color: red; font-size: 1.5em; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-size: 1.5em; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Defects not found</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet, scratch headlight and tail light.</p>