

General Information

Date & Time: 12, Dec, 2025 15:42

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	18,677
Registration No.	NKI3100	Chassis No.	PA2JA8EM2R0145422
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Blackish Red Mica		

Body / Panel Condition



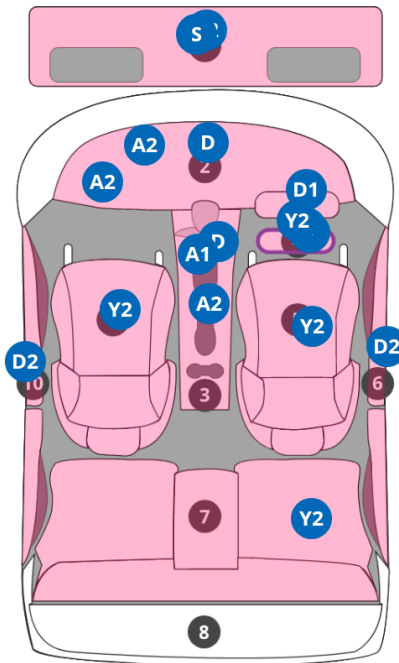
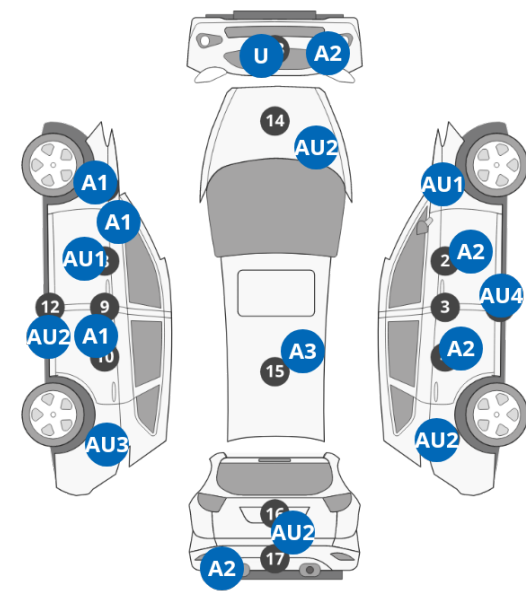
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.6	93	142	82
2	Boot Lid	96.0	92	105	92
3	Roof	93.0	91	93	99/88
4	Left Front Fender	94.1	101	98	83
5	Left Front Door	94.6	97	96	91
6	Center Panel Left				
7	Left Rear Door	95.7	96	98	93
8	Left Back Panel	98.7	103	99	94
9	Right Front Fender	110.0	103	116	111
10	Right Front Door	105.2	104	113	99
11	Center Panel Right				
12	Right Rear Door	102.1	104	99	103
13	Right Back Panel	110.6	108	111	113

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Grime - Small / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small</p>	<p>Remarks Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Wiper - Function - Weak</p>

Inspector Notes

With LTO plate, No warranty booklet and Sparetire and Jack and Tools, scratch and crack tail light and headlight, foul smell, worn tires, no spare key, Abnormal vibration on engine.