

General Information

Date & Time: 12, Dec, 2025 15:34

Make	Toyota	Model	Avanza
YOM	2020	Odo Meter Reading	72,276
Registration No.	CAV2383	Chassis No.	MHKM5EF2FLK024368
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



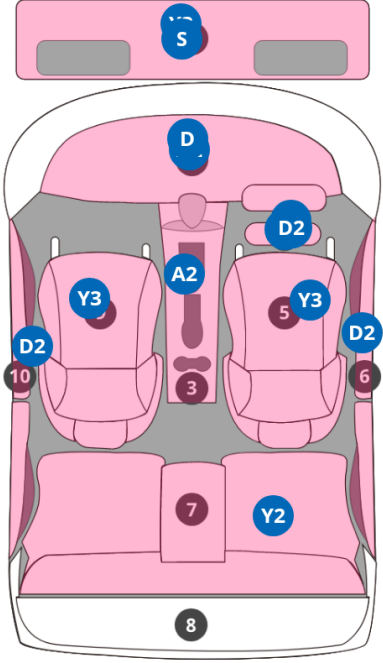
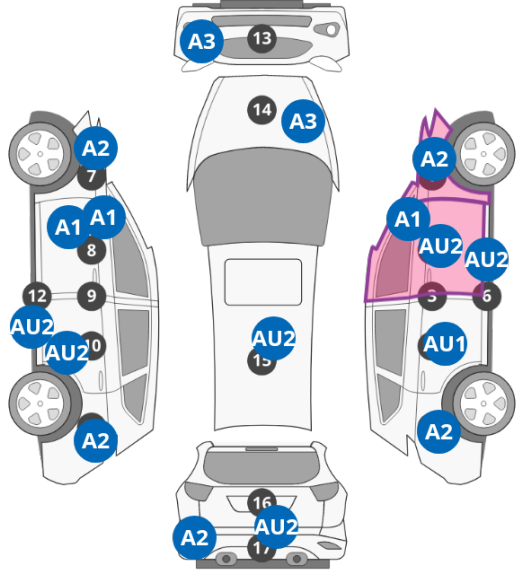
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.9	139	108	98
2	Boot Lid	81.7	83	71	91
3	Roof	86.0	79	85	94/87
4	Left Front Fender	101.8	99	102	105
5	Left Front Door	100.8	111	99	93
6	Center Panel Left				
7	Left Rear Door	97.3	95	96	101
8	Left Back Panel	88.4	80	90	95
9	Right Front Fender	178.0	176	176	182
10	Right Front Door	95.0	96	94	95
11	Center Panel Right				
12	Right Rear Door	97.3	95	99	98
13	Right Back Panel	144.3	145	142	146

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Medium / Overall Interior - Smell - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Mat Other - Worked - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, No spare key, worn tires and Sparetire, No reverse camera, foul smell, possible flooded, warning lamps on, Aircon issue, Scratch and Crack Tail light and Headlight, foglight issue, plate light and Room light issue, Abnormal vibration on engine, Abnormal shiftshock and Sound.