

General Information

Date & Time: 15, Dec, 2025 11:47

Make	Toyota	Model	Avanza
YOM	2020	Odo Meter Reading	75,822
Registration No.	CAV2380	Chassis No.	MHKM5EF2FLK024411
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



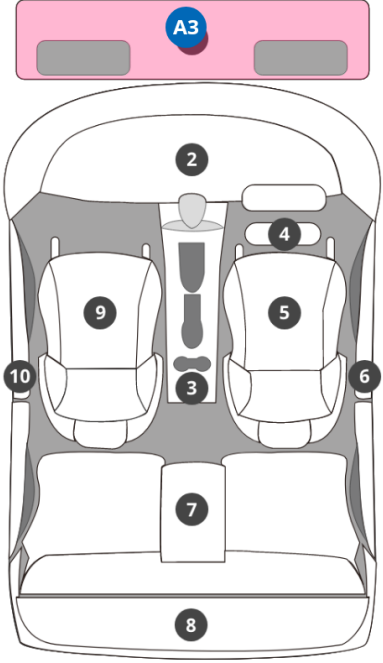
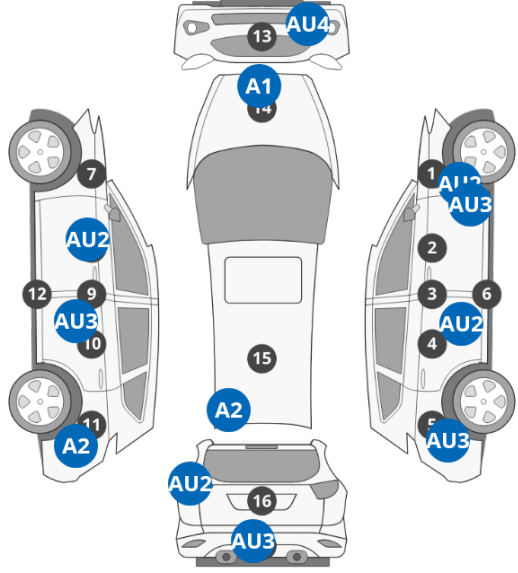
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.1	106	113	93
2	Boot Lid	100.0	99	101	100
3	Roof	94.8	85	90	111/94
4	Left Front Fender	110.6	90	148	94
5	Left Front Door	97.5	101	98	94
6	Center Panel Left				
7	Left Rear Door	96.4	103	98	89
8	Left Back Panel	89.7	84	92	93
9	Right Front Fender	96.1	100	95	94
10	Right Front Door	93.7	93	88	100
11	Center Panel Right				
12	Right Rear Door	100.6	99	103	100
13	Right Back Panel	92.0	94	93	89

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Cut, Crack - Medium	Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with jack and spare tire, 1key, no warranty booklet, scratches on headlight, detached ceiling handle,