

General Information

Date & Time: 12, Dec, 2025 09:53

Make	Suzuki	Model	S-Presso
YOM	2022	Odo Meter Reading	37,808
Registration No.	FAI7741	Chassis No.	MA3FL41S6NA276528
CC	1.0	Transmission	M/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



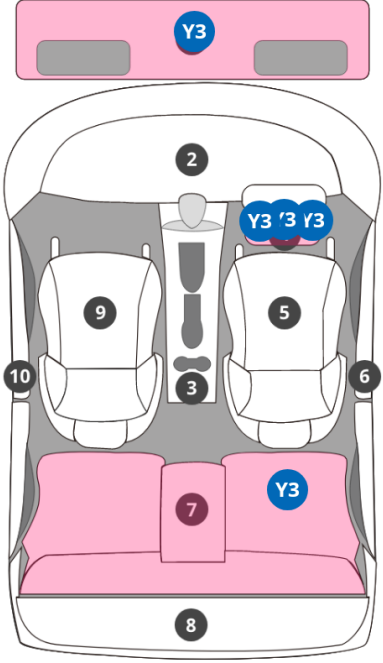
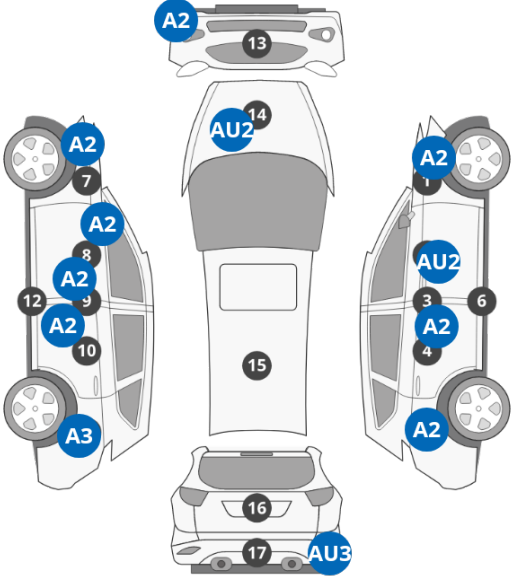
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.3	103	106	104
2	Boot Lid	94.3	97	94	92
3	Roof	103.5	114	111	95/94
4	Left Front Fender	101.4	95	102	107
5	Left Front Door	103.0	104	104	101
6	Center Panel Left				
7	Left Rear Door	99.5	106	100	93
8	Left Back Panel	99.9	104	98	98
9	Right Front Fender	105.6	106	109	102
10	Right Front Door	105.0	103	105	107
11	Center Panel Right				
12	Right Rear Door	93.8	92	92	97
13	Right Back Panel	101.1	100	103	101

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / (R) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Medium / Mat Other - Grime - Medium / (L) Front Floor Mat - Grime - Medium</p>	<p>Remarks (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>Trunk door cannot open due of trunk lever issue. Infultainment display issue.</p>