

General Information

Date & Time: 11, Dec, 2025 08:32

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	39,792
Registration No.	NER7553	Chassis No.	PA1B18F37M4168324
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



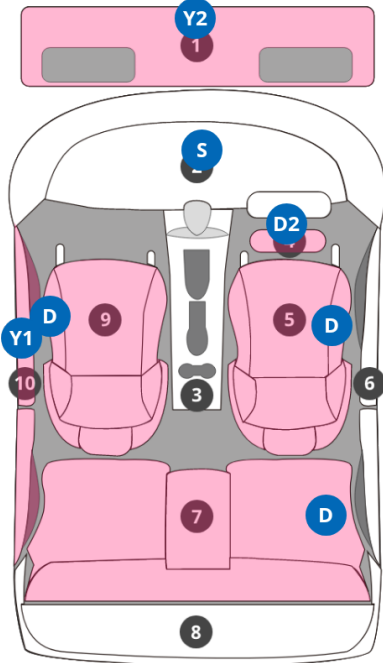
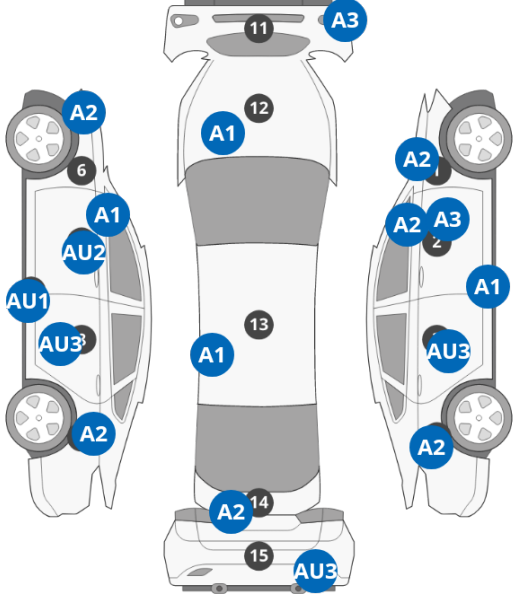
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	109	101	117
2	Boot Lid	112.0	117	104	115
3	Roof	98.7	108	101	96/90
4	Left Front Fender	92.8	92	100	87
5	Left Front Door	99.3	105	99	94
6	Center Panel Left				
7	Left Rear Door	97.8	98	97	99
8	Left Back Panel	106.3	108	100	111
9	Right Front Fender	213.8	452	93	96
10	Right Front Door	101.3	94	97	113
11	Center Panel Right				
12	Right Rear Door	94.3	87	102	94
13	Right Back Panel	109.0	123	101	103

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / Ceiling - Grime - Small / Rear Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (L) Front Trim - Grime - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, incomplete tools, with spare tire, no LTO plate, scratched and cracked tail light, possible flooding, head unit issue</p>