

General Information

Date & Time: 12, Dec, 2025 15:38

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	26,484
Registration No.	FAO7992	Chassis No.	PA1B18F37P4216599
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



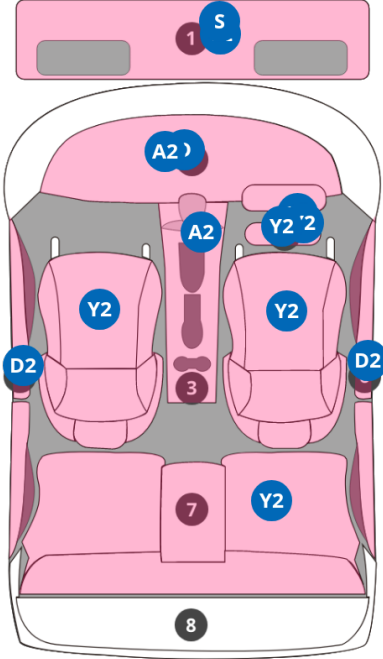
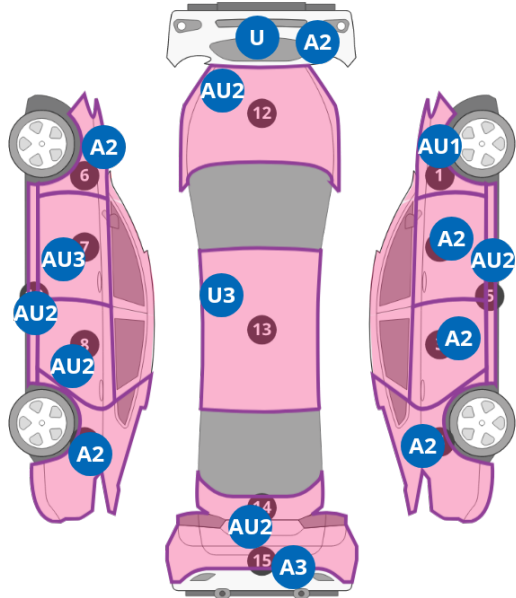
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	122	123	113
2	Boot Lid	173.3	134	217	169
3	Roof	100.3	100	106	102/93
4	Left Front Fender	98.4	102	97	97
5	Left Front Door	99.8	101	97	102
6	Center Panel Left				
7	Left Rear Door	112.0	118	111	107
8	Left Back Panel	114.6	115	117	112
9	Right Front Fender	103.0	104	104	101
10	Right Front Door	109.3	113	113	102
11	Center Panel Right				
12	Right Rear Door	362.6	772	172	144
13	Right Back Panel	448.6	238	106	1,002

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Overall Interior - Smell - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Replaced - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Roof - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Roof - Dent - Medium</p>
Frame Evaluation : B	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

Inspector Notes

With LTO plate and Spare tire, No Tools and Jack and Warranty booklet, scratch headlight and tail light, Worn Tires and Spare tire, No spare key, no reverse camera, foul smell, scratch and crack tail light and headlight, plate light and Room light issue,.